RPO NORTHGATE
PO BOX 26092
REGINA, Saskatchewan S4R 8R7
canada
306-352-0130

hardcorefleet@gmail.com

IARDOOP,

Ship to:

90

يوفي سد دالا

INVOICE

Invoice No.:

760

1

Date:

07/10/2025

Ship Date:

Page:

Re: Order No.

Sold to:

Canada

F-4-14

Business No.:	715800611					
Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
CS6B-I805-D1SP FRT	EACH	1	PTO FREIGHT Subtotal: 11 - GST @5%, PST @6% GST PST	11	5,500.00 100.00	5,500.00 100.00 5,600.00 280.00 336.00
Shipped By:	Tracking N				Total Amount	6,216.00
comment: No re	eturns on electrical ocking fee.	components. Re	turns after 30 days are subject to a 20%	%	Amount Paid	6,216.00
Sold By:	-				Amount Owing	0.00

RPO NORTHGATE
PO BOX 26092
REGINA, Saskatchewan S4R 8R7
canada
306-352-0130

hardcorefleet@gmail.com

Sold to:



INVOICE

Invoice No.:

1207

Date:

07/28/2025

Ship Date:

Page:

Re: Order No.

Ship to:

2011 DODGE RAM 6.7L 3D6WA7EL9BG80683 MIL: 501122, LIC: 354 KSC

Business No.:

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
PTOAD	EACH		JOB #1 REMOVE AND INSTALL PTO REMOVED PTO TO SEND IN TO GET LOOKED AT, DRIVE DEEMED IT NOT REBUILDABLE HAD TO ORDER NEW, CUSTOMER DECIDED TO PRICE OUT THEMSELVES. UNABLE TO MATCH OUR PRICING. REORDERED PART. INSTALLED NEW PTO FOUND PTO FITTING'S ON PTO DIFFERENT FROM ORIGINAL FITTINGS, AIR TECH FABRICATED THE PROPER FITTINGS AND REINSTALLED PROPER FITTINGS AND REINSTALLED PROPER FITTINGS AND REINSTALLED PROPER FITTINGS AND TO PTO TO TEST PTO, POWER AVAILABLE TO PTO BUT PTO NOT RAMPING RPM, SUBLET TO DRIVE, PREVIOUSLY INSTALLED WIRING AND HAD MULTIPLE REPAIRS. NOT INABLING ELECTRICAL LEAD. DRIVE PERFORMED ELCTRICAL REPAIRS. PTO NOW ENGAGES PROPERLY, CHECK OPERATION OF TOW BOX. WORKS PROPERLY. TOOK TRUCK FOR MULTIPLE TEST DRIVES PERFORMS AND SHIFTS AS INTENDED. TOPPED UP SYSTEM WITH FRESH HYDRAULIC OIL. NO LEAKS.			
OIL HYDRAULIC EHC100 BF2-2406-0404 BF2-6500-0404 LABPTO	LTC LTC Each EACH EACH	1	HYDRAULIC OIL AW32 ENV DISPOSAL FEE F-JIC X M JIC ADPATER #4 MJIC X 4 FJIC 90D ADAPTER LABOUR AND TROUBLE SHOOT ELECTRICAL/REPA/RED JOB PARTS SUBTOTAL: \$585.29	11 11 11 11 11 11	39.59 84.62 0.95 6.66 5.12 448.35	39.5 84.6 0.9 6.6 5.1 448.3
LB4110	Each	14	LABOUR JOB SUBTOTAL: \$2895.29	11	165.00	2,310.0
ss	EACH	1	SHOP SUPPLIES	11	115.50	115.50
	EACH	-1	AGREEMENT WAS MADE BETWEEN CUSTOMER AND RYAN		1,500.00	-1,500.00
Comment: A 3%	6 surcharge will be	applied to all cred	dit card transactions		Continu	e

RPO NORTHGATE PO BOX 26092 REGINA, Saskatchewan S4R 8R7 canada 306-352-0130

hardcorefleet@gmail.com

ARDCON.

INVOICE

Invoice No.:

1207

Date:

07/28/2025

Ship Date:

Page:

2

Re: Order No.

Sold to:

Ship to:

2011 DODGE RAM 6.7L 3D6WA7EL9BG80683 MIL: 501122, LIC: 354 KSC

Canada

Business No.:

Item No.	. Unit	Quantity	Description	Tax	Unit Price	Amount
			Subtotal:			1,510.79
			11 - GST @5%, PST @6%			
	=		GST PST			150.55 180.66
Shipped By:	Tracking N	umber:			Total Amount	1,842.00
Comment:	A 3% surcharge will be	applied to all cred	dit card transactions		Amount Paid	0.00
Sold By:					Amount Owing	1,842.00

Hardcore Fleet Service Inc.
RPO NORTHGATE
PO BOX 26092
REGINA, Saskatchewan S4R 8R7 canada 306-352-0130

hardcorefleet@gmail.com

Sold to:



INVOICE

Invoice No.:

639

Date:

06/25/2025

Ship Date:

Page:

Re: Order No.

Ship to:

2011 DODGE RAM 5500 6.7L 3D6WA7EL9BG580683 MIL: 501072, LIC: 354 KSC

Canada

Business No.:

Item No. Un	t Quantity	Description	Tax	Unit Price	Amount
		JOB #1 WILL NOT MOVE BROUGHT TRUCK IN USING FORKLIFT, HOISTED INTO THE AIR, DRAINED TRANNY FLUID. REMOVED ALL ELECTRICAL CONNECTORS AND SHIFT CABLE. SUPPORTED WITH TRANNY JACK REMOVED TRANNY SUPPORT CROSSMEMEBER. REMOVED BOLTS CONNECTING TORQUE CONVERTER TO FLY WHEEL. REMOVED STARTER. REMOVED BOLTS CONNECTING BELL HOUSING TO ENGINE. REMOVED HYDRAULIC LINES FROM PTO. TRIED TO FREE UP TRANSMISSION ONCE EVERYTHING WAS LOOSENED, HAD TO HEAT WITH TORCH AND CUT INPUT SHAFT ON TRANSMISSION BECAUSE TRANS WAS SEIZED UP, ONCE INPUT SHAFT WAS CUT, WAS ABLE TO FREE UP TRANSMISSION AND LOWER DOWN WITH JACK, BEGAN TO STRIPP ALL PARTS OFF TRANSMISSION TO PREP FOR REBUILD, USED CRANE TO LIFT TRANS FROM JACK TO A PALLET FOR TRANSPORTATION TRUCK HAS BADLEY RUSTED LINES WHICH BEGAN TO LEAK AFTER REMOVAL OF TRANS, TALKED WITH CUSTOMER SENT PHOTOS GIVEN OK TO REPLACE REMOVED LINES AND SENT IN FOR REBUILD AS ONES FROM DEALERSHIP WERE INCORRECT FOR THE APPLICATION THEY WERE GOING ONTO TO BEFORE INSTALLING TRANSMISSION FLUSHED ALL TRANSMISSION LINES AND COOLER TO HELP WITH ANY DEBRIS AS TRANSMISSION HAD GERNATED AND CAUSED METAL PARTICALS ALL OVER.			
nment: No returns on el	ectrical components. R	elurns after 30 days are subject to a 20%		Cont	inue

RPO NORTHGATE PO BOX 26092 REGINA, Saskatchewan S4R 8R7 canada 306-352-0130

hardcorefleet@gmail.com

Sold to:



INVOICE

Invoice No.:

639

2

Date:

06/25/2025

Ship Date:

Page:

Re: Order No.

Ship to:

2011 DODGE RAM 5500 6.7L 3D6WA7EL9BG580683 MiL: 501072, LIC: 354 KSC

Canada

(°---

Business No.:

	- WHEN TRANSMISSION ARRIVED BACK AT SHOP REBUILD, REINSTALLED HYDRAULIC LINES TO PTO, REINSTALLED BELL HOUSING TO ENGINE, FLY WHEEL, TRANNY		
	SUPPORT CROSS MEMBER, CONNECTORS AND REPLACE FILTER AND FLUID ALL SENSORS BRACKETS AND PTO WERE REINSTALLED BACK ONTO TRNSMISSION,, TRANS WAS LIFTED ONTO TRANS JACK, VEHICLE RE HOISTED IN AIR, TRANS LIFTED INTO PLACE ALL BELL HOUSING BOLTS FASTENED, ALL ELECTRICAL RECONNECTED. CROSS MEMBER INSTALLED BACK INTO PLACE, TRANS SHIFT LINKAGE ADJUSTED, FLUID FILLED TEST DROVE USED SCAN TOOL TO RELEARN SHIFT PATTERNS. TEST DRIVEN AGAIN. AFTER TRANSMISSION INSTALLED, FILL FLUID, RUN UNIT, BACK OUT OF SHOP IDLE ENGINE TO CHECK FLUID LEVELS HELD FOR AN HOUR. FLUID LEVELS HELD FOR AN HOUR. FLUID LEVEL OK. TEST DRIVE AND TRANS WILL NOT MOVE, PERFORM SCAN TEST P2806 TRANS RANGE SENSOR ALIGNMENT CALLED TRANS TECH WED MAY 2B DISCUSSED ISSUE ADVISED TO PERFORM SENSOR ALIGNMENT. ROUTINE. PERFORMED SUCCESSFUL PRINDLE ILLUMINATION MATCHES SHIFT PATTERN FROM COLOUMN SHIFT, UNIT WILL STILL NOT MOVE REMOVE LOWER BELL HOUSING COVER CONVERTER AND FLYWHEEL SPIN, TRANS WILL NOT ENGAGE. AS PER DISCUSSION WITH TRANS TECH REMOVE PAN AND INSPECT, SLIGHT MEDAL FILLINGS FOUND IN PAN. PICTURES TAKEN.		

RPO NORTHGATE PO BOX 26092 REGINA, Saskatchewan S4R 8R7 canada 306-352-0130

hardcorefleet@gmail.com

Sold to:



INVOICE

Invoice No.:

639

Date:

06/25/2025

Ship Date:

Page:

3

Re: Order No.

Ship to:

Business No.: 715800611

item No. Unit Quant		Quantity	Description	Tax	Unit Price	Amount	
			ROSTER COMB AND LINKAGE GOOD. SUSPECT INTERNAL ISSUE. SPOKE WITH TRANS TECH CHECK FLOW FROM BOTH TRANS LINES MONITOR LIVE DATA NO OUTPUT SPEED SENSOR READING. 0 RPM ALL GEARS. ENGINE RUNNING.				
			REMOVE TRANS OIL LINES AT TRANSMISSON EACH SEPERATLY AS PER TRANS TEST, MEASURE OIL FLOW FROM EACH LINE FLOW IS GOOD. EQUAL FLOW MEASURED AT LINES. AWAITING RETURN CALL FROM TRANS TECH, AGAIN SPOKE WITH TRANS TECH.				
			"AS PER TRANS TECH TRANSMISSION REMOVAL AND SEND BACK REQUIRED" - REPEAT TRANSMISSION REMOVAL PROTOCALS AGAIN, REMOVE TRANSMISSION, UNABLE TO MOVE INPUT SHAFT IN ANY GEAR WHEN MANUALLY SHIFTED. INTERNAL TRANSMISSION ISSUE, RETURNED TO TRANS TECH FOR SECOND GO OVER.				
			TRANS TECH INSPECTED UNIT STATING NO OBVIOUS SIGNS OF FAILURE, THEY SUPPLIED NEW RE-MAN TRANS VS REBUILT ONE TO TRY, INSTALL NEW TRANS REPEAT STEPS ON RE HOOKING UP THE LINES, WIRING ETC. AS PER DISCUSSION WITH TRANS INSTALL PTO COVER				
			AND RUN UNIT TESTING TRANSMISSION. LABOUR BREAK DOWN 10HR FOR TRANSMISSION R&I, 2HR FOR COOLER LINES INSTALL, 4HR DIAGNOSE TRANSMISSION DONE TWICE, 2.5HR FLUSH ALL LINES DONE TWICE, 1.5 REPROGRAM TRANSMISSION DONE TWICE				
S68RC HC1000	EACH EACH		TRANSMISSION EHC	11 11	11,522.59 10.40	11,522.5 10.4	
omment:	do entruno en electri	and components. F	teturns after 30 days are subject to a 20%		Continu	10	

RPO NORTHGATE PO BOX 26092 REGINA, Saskatchewan S4R 8R7 canada 306-352-0130

hardcorefleet@gmail.com

Sold to:



INVOICE

Invoice No.:

639

Date:

06/25/2025

Ship Date:

Page:

4

Re: Order No.

Ship to:

2011 DODGE RAM 5500 6.7L 3D6WA7EL9BG580683 Mil: 501072, LIC: 354 KSC

CONTRACT

Business No.:

Item No.	Unit	Quantity	Description	Tex	Unit Price	Amount
K465KD	EACH	1.0	TRANS COOLER FLUSH	11	30.75	30.7
FRT	EACH	1.0	FRIEGHT CHARGE	11 I	250.00	250.0
58846	EACH		TRANS FILTER	11	64.09	64.0
EHC50	Each		ENV DISPOSAL FEE	ii	0.50	0.56
68019688AA	EACH		TRANS FILTER	lii l	344.49	344.4
			MOPAR ATF FLUID	lii l	23.65	662.20
OIL 5189966AE	LTR				0.15	4.20
EHC10	Each		ENV DISPOSAL FEE	11		
LINES	EACH		FABRICATE LINES	11	729.55	729.5
CHM313	Each		397GM BRAKE CLEAN	11	7.50	22.50
GRO836021	Each	10.0	11-3/4 ZIP TIES	11	0.10	1.00
	1		JOB PARTS SUBTOTAL: \$15,150.61			
LB4110	Each	20.0	LABOUR	11	165.00	3,300.00
			JOB SUBTOTAL: \$18,450.61	11		
CHM74055 EHC100 5526-038 PET-8 CHM313 LB4110	JUG Each FOOT Each Each	3.0 2.0 2.0 1.0	JOB #2 UREA TANK REMOVED OLD UREA TANK THAT PLUMBED FOR EXTRA COOLANT, INSTALLED NEW COOLANT LINES IN PLACE OF OLD RUSTED LINES WHICH TOOK TIME TO REMOVE, INSTALLED TANK BACK INTO PLACE AFTER FILLED WITH COOLANT IN RADIATOR, RESERVOIR AND LINES. ANTIFREEZE 50/50 3.78L RED ENV DISPOSAL FEE 3/8 SILICONE HEATER HOSE 13/16 CLAMP 397GM BRAKE CLEAN JOB PARTS SUBTOTAL: \$77/26 LABOUR JOB SUBTOTAL: \$489.76	11 11 11 11 11	15.64 1.00 6.68 3.24 7.50	46.97 3.00 13.36 6.48 7.50 412.50
			JOB #3 PTO - PTO APPERARED TO BE OPERATIONAL ON TRANS WHEN UNIT WAS UP TO OPERATING TEMPS, QUICK LEARN IN PROCESS COULD HEAR ABNORMAL NOISE IN BELL HOUSING AREA AT THIS TIME DOES NOT OPERATE PTO WE INSURED ALL LINES WERE HOOKED UP, PTO WAS FULL OF FLUID, ALL			

RPO NORTHGATE
PO BOX 26092
REGINA, Saskatchewan S4R 8R7
canada
306-352-0130

hardcorefleet@gmail.com

AND SOME THE STATE OF THE STATE

INVOICE

Invoice No.:

639

5

Date:

06/25/2025

Ship Date:

Page:

Re: Order No.

Sold to:

Ship to:

2011 DODGE RAM 5500 6.7L 3D6WA7EL9BG580683 MIL: 501072, LIC: 354 KSC

Canada

Business No.:

	ELECTRICAL CONNECTIONS WITH PROPERLY INSTALLED. UNIT LEFT SHOP BEGAN TO ADMIT ABNORMAL NOISE, AT THIS TIME FURTHER INVESTIGATION REQUIRED HAD DISCUSSION WITH MANAGEMENT OVER ABNORMAL NOISE, AT THIS TIME ABNORMAL NOISE BECAME MORE PROINENT IN ATTEMPTS TO BRING UNIT BACK TO SHOP PREFORM TRANS LINE TESTS REMOVE PTO FROM UNIT AND INSPECTED UPON INSPECTION FOUND PTO FROM UNIT PTO OUTER BEARING HAD SEIZED AT THIS TIME SENT PTO TO DRIVE PRODUCTS THEY DEEMED UN REPAIRABLE PROVIDED CUSTOMER WITH PTO REPLACMENT CUSTOMER DENIED FURTHER REPAIRS AT THIS TIME WITH PTO AS CUSTOMER USES COMMECIAL TRUCK INSTEAD. CUSTOMER IS RESPONSIBLE FOR PROVIDING PTO.			
8.0	LABOUR JOB PARTS SUBTOTAL: \$1320.00	11	165.00	1,320.0
	SHOP SUPPLIES	11	251.62	251.62
		11	5,000.00	-5,000.00
-1.0	PRE PAYMENT TAKEN Subtotal:	1 1	0,000.00	14.003.6
				1 1,000 (01
	11 - GST @5%, PST @6% GST PST			700 2(840.23
Tracking Number:			Total Amount	15,544.00
s on electrical components. F	Returns after 30 days are subject to a 20%		Amount Paid	0.0
			Amount Owing	15,544.0
s OI	•	n electrical components. Returns after 30 days are subject to a 20%	n electrical components. Returns after 30 days are subject to a 20%	n electrical components. Returns after 30 days are subject to a 20% Amount Paid



760 1ST AVE EAST REGINA SK S4N 5T6

Phone: 306-751-8140 Fax: 306-949-1031 INVOICE
DATE October 21, 2024
NUMBER 0000201370
CUSTOMER NO. \$35

www.provincialhydraulics.com

BILL TO:

PREFERRED CASH CUSTOMER

SHIP TO:

P.O. NUMBER	SALESPE	RSON		ORDER DATE	REQ	. DATE C	RDER NUMBER
UNIT 25	W/O 17	931		26-Sep-24			0000800543
F.O.B.	,	SHIP VIA	- t			TERMS	
PROV HYDS		PICK UP					×
PART NUMBER		044	DEC	QUANTITY	B C	UNIT	EXTENDED PRICE
DESCRIPTION	1	OM	REQ.	SHIPPED	В.О.	PRICE	PRICE
REMOVE MAIN CYLINDER OF FLAT BED T TRUCK UNIT 25- RAM 5500 SASK PLATE # 354 KSC	ow						
DIFFICULT TO REMOVE OFF UNIT- RUSTY SEIZED CYLINDER ROD DAMAGED BAD AND SEIZ B.E.R.	1						
REPLACE CYLINDER/ REPLACE 2 HOSES TESTED FINE	TEST						
1001166856-JER MAIN CYLINDER-3.00/1.75X127.88-247.88	EA		1	1		3,846.15000	3,846.15
4691000429-JER 'PIN 1.250X5.375	EA		1	1		130.00000	130.00
472LT-6-15.5"-6FJX-6FJX HOSE ASSEMBLY	EA		1 a	1		52.50000	52.50
472LT-6 3/8" LOW TEMP HOSE (-70 F) - 5000 PSI SERIES)	(43 EA		1.5000	00 1.50000			N/C
6PC-6FJX 10643-6-6	EA		2	2			N/C
We appreciate your business!						CONTINUED	
		1			'	COMINUED	
		1)	1				
	(Sary 12	h				
	127	X III,					
Business Number 872585476RT001		0					



760 1ST AVE EAST REGINA SK S4N 5T6

Phone: 306-751-8140 Fax: 306-949-1031 INVOICE
DATE October 21, 2024
NUMBER 0000201370
CUSTOMER NO. \$\$\$

cialhydraulics.com

MILL TO:

PREFERRED CASH CUSTOMER

Business Number 872585476RT001

SHIP TO:

. . .

P.O. NUMBER	SALESPERSON		ORDE	R DATE	REQ	. DATE	OR	DER NUMBER
UNIT 25	W/O 17931		26-S	ер-24				0000800543
F.O.B.	SHIP VI	Ą				TERMS		
PROV HYDS	PICK UP							
PART NUMBER DESCRIPTION	UOM	REQ		NTITY PPED	в.о.	UNIT PRICE		PRICE
CRIMP HOSE END(S)	EA	2		2				N/C
472LT-6-17.5"-6FJX-6FJX HOSE ASSEMBLY	EA	1		1		52.50	000	52.50
472LT-6 3/8" LOW TEMP HOSE (-70 F) - 5000 PSI (45 SERIES)	EA	1.5	0000	1.50000				N/C
6PC-6FJX 1,0643-6-6	EA	2		2				NC
CRIMP HOSE END(S)	EA	2		2				N/C
6MB-6MJ90 1195-06-06 (\$3649-6)	EA	1		1		7.00	0000	7.0
6MB-6MJ 1115-06-06 (S36488-6)	EA	5		5		3.00	0000	15.0
SHOP LABOUR (BW) SHOP LABOUR	EA	9.5	0000	9.50000		148.00	0000	1,406.0
SHOP LABOUR (TD) SHOP LABOUR	EA	7.5	0000	7.50000		149.00	0000	1,117.5
We appreciate your business!						CONTINU	ED	



760 1ST AVE EAST REGINA SK S4N 5T6

Phone: 306-751-8140 Fax: 306-949-1031 INVOICE
DATE October 21, 2024
NUMBER 0000201370
CUSTOMER NO. \$\$\$

cialhydraulics.com

≴ILL TO:

PREFERRED CASH CUSTOMER

SHIP TO:

. .

P.O. NUMBER	SALESPERSON		ORDER DATE	REC	. DATE	ORDER NUMBER
UNIT 25	W/O 17931		26-Sep-24			0000800543
F.O.B.	SHIP VI	Α			TERMS	
PROV HYDS	PICK UP					
PART NUMBER			QUANTITY		UNIT	EXTENDED
DESCRIPTION	MOU	REQ	. SHIPPED	B.O.	PRICE	PRICE
S/S SHOP SUPPLIES	EA	1	1		142.0000	142.00
THANK YOU FOR YOUR ORDER						
¥						į
×						
					,	
	** (4)					-
We appreciate your business!				N	ET AMOUN	T 6,768.65
					FREIGH	
					G.S.1 P.S.3	1
Business Number 872585476RT00	1				TOTAL DU	E \$7,513.20