

	ER33	1FVACYFE6LHLC2953	YBY3877	8-9-2024	0.00	112.00	LOOSE CHAIN CALABRATE TROLLY SENSOR WELD BROKEN HOSE BRACKET
	ER33	1FVACYFE6LHLC2953	YBY3877	5-9-2024	111.26	111.26	JACK UP TRUCK TRUCK, REMOVE TIRES, BACK BRAKES OFF REMOVE DRUMS, TAKE WIRE WHEEL TO SHOES, THEN GRIND AND BEVEL SHOE EDGES. WHEN BACKING OFF LH SLACK FOUND ADJUSTER VERY WEAK, R&R SLACK. CAGE BRAKE PULL SLACK REINSTALL AND TIME ADJUSTER. GREASED BOTH SIDES SLACKS AND SCAM TUBES. REINSTALL BRAKE COMPONENTS, WHEELS AND ADJUSTED BRAKES. TORQUES WHEELS TO 450 FT/LBS.
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	108.66	108.66	5/30 - A/C recharge. Replace cabin air filter. Replace two A/C lines 6/5 -
	ER33	1FVACYFE6LHLC2953	YBY3877	4-26-2024	0.00	100.00	clean and weld cane
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	0.00	100.00	dot
	ER33	1FVACYFE6LHLC2953	YBY3877	3-25-2025	0.00	100.00	DOT FINISH REPLACED COOLANT LEVEL SENSOR DIAG ENGINE LIGH
Lot#125	ER34	1FVACYFE4LHLC2952	YBY3876	3-19-2024	5,618.90	5,618.90	found pto switch no working all the time orderd fixed broken tilt pin 3/19 Repaired broken collection arm that fell off during route. Replaced main beam. regreased. calibrated. had to cut off and reweld hose arm bracket to proper orientation and placemet. removed broken ladder part from left side. Still need to add locking washer part. Part Number not in dossier Replaced arm harness
	ER34	1FVACYFE4LHLC2952	YBY3876	4-12-2024	5,030.05	5,030.05	4/10 GS - hydro leak from trollet pump control cube. Hydro level not low. REPLACED CRACKED ARM.
	ER34	1FVACYFE4LHLC2952	YBY3876	6-5-2024	2,469.00	2,469.00	Truck came in for slow hydro leak and to discuss A/C issues. Drained the Hydro from valve section area. Topped of the hydro tank. (Patrick M. filled the hydro. is entered in Dossier under separate & closed RO case.) GS - Assisted Pirtek with replacement of steel line. Night hydraulic spill cleanup. Service call to truck on route with arm acting up. adjusted arrangement of upper arm hoses. make hoses and replaced leaking ones 6/3 GS & PM Replace missing fuse for PTO. 1x SS part. 6/3 GS & JS service call on route to address overheating hydro system. JS adjusted pack cycle. Waiting to hear from driver/fleet if overheating persists. May need additional hydro coolers. 6/4 - Slow arm speed complaint. Is set to slower to help with overheating hydro issue.
	ER34	1FVACYFE4LHLC2952	YBY3876	1-2-2025	1,925.20	1,925.20	REMOVED AND REPLACED ACTUATOR BOLTS BROKE OFF AND IN TURBO HAD TO REMOVE IT
	ER34	1FVACYFE4LHLC2952	YBY3876	3-21-2025	1,648.86	1,648.86	FIXED ARM THAT WAS INCONSISTENT REPLACED GRABBER CYLINDER AMD CHECKED ARM TO MAKE SURE IT OPOPERATES
	ER34	1FVACYFE4LHLC2952	YBY3876	4-26-2024	1,354.57	1,354.57	pto kicking out random fix tilt bushing hold down replaced tilt cylinger and clocked hose replaced broken hoses wrapped hoses 4/23 - replaced upper arm hoses. Replaced missing left steer hub plug. Hub fluid looks clear and uncontaminated.
	ER34	1FVACYFE4LHLC2952	YBY3876	4-26-2024	1,152.20	1,152.20	pto kicking out random fix tilt bushing hold down replaced tilt cylinger and clocked hose replaced broken hoses wrapped hoses 4/23 - replaced upper arm hoses. Replaced missing left steer hub plug. Hub fluid looks clear and uncontaminated.
	ER34	1FVACYFE4LHLC2952	YBY3876	3-7-2024	1,152.20	1,152.20	Replaced arm out hydraulic hose
	ER34	1FVACYFE4LHLC2952	YBY3876	3-7-2024	987.60	987.60	replaced leaking hoses to trolly motor replaced tilt harness replaced arm harness filled service call leaking replaced oring at valve
	ER34	1FVACYFE4LHLC2952	YBY3876	3-20-2026	922.87	922.87	REPLACED THE PTO
	ER34	1FVACYFE4LHLC2952	YBY3876	11-25-2021	734.92	734.92	NEED TO REPLACE RADIATOR. finished installing radiator
	ER34	1FVACYFE4LHLC2952	YBY3876	4-14-2025	535.20	535.20	REPLACED CHAIN
	ER34	1FVACYFE4LHLC2952	YBY3876	2-25-2022	476.28	476.28	replaced hydraulic hose. filled tank with 80 qts. replaced trolly rollers
	ER34	1FVACYFE4LHLC2952	YBY3876	1-16-2025	469.56	469.56	ARM HARNESS R&R TOP ARM HOSES
	ER34	1FVACYFE4LHLC2952	YBY3876	3-21-2025	469.56	469.56	FIXED ARM THAT WAS INCONSISTENT REPLACED GRABBER CYLINDER AMD CHECKED ARM TO MAKE SURE IT OPOPERATES
	ER34	1FVACYFE4LHLC2952	YBY3876	12-31-2021	464.68	464.68	driver bent double finger so needed to replace it
	ER34	1FVACYFE4LHLC2952	YBY3876	7-17-2025	0.00	460.80	ADDED HYDRO AND ATF
	ER34	1FVACYFE4LHLC2952	YBY3876	12-17-2024	460.11	460.11	REPLACED AEM HARNESS FOR GRABBER
	ER34	1FVACYFE4LHLC2952	YBY3876	12-1-2024	460.11	460.11	REPLACED GRABBER SENSOR HARNESS DROVE TO TRUCK ON CALL REPLACED CART FROM ARM AND BROUGHT TRUCK BACK IN THE SHOP SECURED SENSOR BACK TOGETHER
	ER34	1FVACYFE4LHLC2952	YBY3876	4-12-2024	453.02	453.02	Replaced arm harness 4/10 GS - hydro leak from trollet pump control cube. Hydro level not low. REPLACED CRACKED ARM.
	ER34	1FVACYFE4LHLC2952	YBY3876	3-7-2024	453.02	453.02	replaced leaking hoses to trolly motor replaced tilt harness replaced arm harness filled service call leaking replaced oring at valve

	ER34	1FVACYFE4LHLC2952	YBY3876	7-11-2025	0.00	442.80	ADDED ATF
	ER34	1FVACYFE4LHLC2952	YBY3876	6-5-2024	0.00	420.00	Truck came in for slow hydro leak and to discuss A/C issues. Drained the Hydro from valve section area. Topped of the hydro tank. (Patrick M. filled the hydro. is entered in Dossier under separate & closed RO case.) GS - Assisted Pirtek with replacement of steel line. Night hydraulic spill cleanup. Service call to truck on route with arm acting up. adjusted arrangement of upper arm hoses. make hoses and replaced leaking ones 6/3 GS & PM Replace missing fuse for PTO. 1x SS part. 6/3 GS & JS service call on route to address overheating hydro system. JS adjusted pack cycle. Waiting to hear from driver/fleet if overheating persists. May need additional hydro coolers. 6/4 - Slow arm speed complaint. Is set to slower to help with overheating hydro issue.
	ER34	1FVACYFE4LHLC2952	YBY3876	7-27-2022	381.00	381.00	replaced the arm chain. I think its the wrong part number
	ER34	1FVACYFE4LHLC2952	YBY3876	6-5-2024	0.00	380.00	Truck came in for slow hydro leak and to discuss A/C issues. Drained the Hydro from valve section area. Topped of the hydro tank. (Patrick M. filled the hydro. is entered in Dossier under separate & closed RO case.) GS - Assisted Pirtek with replacement of steel line. Night hydraulic spill cleanup. Service call to truck on route with arm acting up. adjusted arrangement of upper arm hoses. make hoses and replaced leaking ones 6/3 GS & PM Replace missing fuse for PTO. 1x SS part. 6/3 GS & JS service call on route to address overheating hydro system. JS adjusted pack cycle. Waiting to hear from driver/fleet if overheating persists. May need additional hydro coolers. 6/4 - Slow arm speed complaint. Is set to slower to help with overheating hydro issue.
	ER34	1FVACYFE4LHLC2952	YBY3876	3-19-2024	0.00	340.00	found pto switch no working all the time orderd fixed broken tilt pin 3/19 Repaired broken collection arm that fell off during route. Replaced main beam. regreased. calibrated. had to cut off and reweld hose arm bracket to proper orientation and placemet. removed broken ladder part from left side. Still need to add locking washer part. Part Number not in dossier
	ER34	1FVACYFE4LHLC2952	YBY3876	4-26-2024	0.00	340.00	pto kicking out random fix tilt bushing hold down replaced tilt cylinder and clocked hose replaced broken hoses wrapped hoses 4/23 - replaced upper arm hoses. Replaced missing left steer hub plug. Hub fluid looks clear and uncontaminated.
	ER34	1FVACYFE4LHLC2952	YBY3876	3-26-2024	329.20	329.20	arm stuck
	ER34	1FVACYFE4LHLC2952	YBY3876	3-26-2024	329.20	329.20	run new pto wire harness test to see if it cut out after unit pto stayed running
	ER34	1FVACYFE4LHLC2952	YBY3876	5-23-2025	304.62	304.62	REPLACE FINGER BUSHINGS
	ER34	1FVACYFE4LHLC2952	YBY3876	3-20-2026	0.00	295.20	REPLACED THE PTO
	ER34	1FVACYFE4LHLC2952	YBY3876	4-14-2025	284.88	284.88	REPLACED CHAIN
	ER34	1FVACYFE4LHLC2952	YBY3876	2-25-2022	284.40	284.40	filled 120 qts of hydro fluid
	ER34	1FVACYFE4LHLC2952	YBY3876	6-5-2024	263.24	263.24	Truck came in for slow hydro leak and to discuss A/C issues. Drained the Hydro from valve section area. Topped of the hydro tank. (Patrick M. filled the hydro. is entered in Dossier under separate & closed RO case.) GS - Assisted Pirtek with replacement of steel line. Night hydraulic spill cleanup. Service call to truck on route with arm acting up. adjusted arrangement of upper arm hoses. make hoses and replaced leaking ones 6/3 GS & PM Replace missing fuse for PTO. 1x SS part. 6/3 GS & JS service call on route to address overheating hydro system. JS adjusted pack cycle. Waiting to hear from driver/fleet if overheating persists. May need additional hydro coolers. 6/4 - Slow arm speed complaint. Is set to slower to help with overheating hydro issue.
	ER34	1FVACYFE4LHLC2952	YBY3876	10-3-2024	0.00	260.00	shorted wiring
	ER34	1FVACYFE4LHLC2952	YBY3876	3-20-2024	246.30	246.30	Replaced PTO solenoid
	ER34	1FVACYFE4LHLC2952	YBY3876	3-20-2026	246.30	246.30	REPLACED THE PTO
	ER34	1FVACYFE4LHLC2952	YBY3876	3-19-2024	0.00	240.00	found pto switch no working all the time orderd fixed broken tilt pin 3/19 Repaired broken collection arm that fell off during route. Replaced main beam. regreased. calibrated. had to cut off and reweld hose arm bracket to proper orientation and placemet. removed broken ladder part from left side. Still need to add locking washer part. Part Number not in dossier
	ER34	1FVACYFE4LHLC2952	YBY3876	8-14-2024	0.00	224.00	HUB CAP LOOSE 8/12
	ER34	1FVACYFE4LHLC2952	YBY3876	1-2-2025	0.00	220.00	REMOVED AND REPLACED ACTUATOR BOLTS BROKE OFF AND IN TURBO HAD TO REMOVE IT
	ER34	1FVACYFE4LHLC2952	YBY3876	9-24-2024	0.00	212.00	NO NOTES
	ER34	1FVACYFE4LHLC2952	YBY3876	1-13-2022	209.44	209.44	unit came in with hydro lek . i replaced the hose and ran arm i didnt see any leaks. i sent unit our to route
	ER34	1FVACYFE4LHLC2952	YBY3876	2-16-2024	206.40	206.40	filled coolant and hydro
	ER34	1FVACYFE4LHLC2952	YBY3876	4-16-2024	206.39	206.39	PM Service - 1x lube filter, 2x fuel filters. Greased everything. Fingers are closing too tightly because cylinder connecting part is bent. Will bend out during future visit.
	ER34	1FVACYFE4LHLC2952	YBY3876	3-19-2024	0.00	200.00	found pto switch no working all the time orderd fixed broken tilt pin 3/19 Repaired broken collection arm that fell off during route. Replaced main beam. regreased. calibrated. had to cut off and reweld hose arm bracket to proper orientation and placemet. removed broken ladder part from left side. Still need to add locking washer part. Part Number not in dossier

	ER34	1FVACYFE4LHLC2952	YBY3876	3-7-2024	0.00	200.00	replaced leaking hoses to trolly motor replaced tilt harness replaced arm harness filled service call leaking replaced oring at valve
	ER34	1FVACYFE4LHLC2952	YBY3876	2-25-2022	189.60	189.60	replaced hydraulic hose. filled tank with 80 qts. replaced trolley rollers
	ER34	1FVACYFE4LHLC2952	YBY3876	5-7-2025	0.00	189.00	WELD FLOOR
	ER34	1FVACYFE4LHLC2952	YBY3876	9-20-2024	0.00	172.00	SHORT ISSUE REPLACED TROLLEY AND WARM WIRE HARNESS STILL ISSUES CHECKED FOR FUSE ISSUES STILL ISSUES
	ER34	1FVACYFE4LHLC2952	YBY3876	3-17-2025	168.15	168.15	TILT REBUILD
	ER34	1FVACYFE4LHLC2952	YBY3876	4-16-2024	164.60	164.60	arm not operating found bad harness
	ER34	1FVACYFE4LHLC2952	YBY3876	4-16-2024	164.60	164.60	Bend lower double finger so it stops interfering with single
	ER34	1FVACYFE4LHLC2952	YBY3876	2-26-2024	164.60	164.60	filled coolant and washer fluid
	ER34	1FVACYFE4LHLC2952	YBY3876	2-16-2024	164.60	164.60	filled coolant and hydro
	ER34	1FVACYFE4LHLC2952	YBY3876	4-1-2024	164.60	164.60	find leak fill tank
	ER34	1FVACYFE4LHLC2952	YBY3876	3-29-2024	164.60	164.60	flat tire
	ER34	1FVACYFE4LHLC2952	YBY3876	3-19-2024	164.60	164.60	found pto switch no working all the time ordered fixed broken tilt pin 3/19 Repaired broken collection arm that fell off during route. Replaced main beam. regreased. calibrated. had to cut off and reweld hose arm bracket to proper orientation and placemet. removed broken ladder part from left side. Still need to add locking washer part. Part Number not in dossier
	ER34	1FVACYFE4LHLC2952	YBY3876	4-26-2024	164.60	164.60	recover vac and charged a/c still inop needs more looking into
	ER34	1FVACYFE4LHLC2952	YBY3876	4-12-2024	164.60	164.60	Replaced arm harness 4/10 GS - hydro leak from trolley pump control cube. Hydro level not low. REPLACED CRACKED ARM.
	ER34	1FVACYFE4LHLC2952	YBY3876	2-26-2024	164.60	164.60	Replaced prox sensor on rear door
	ER34	1FVACYFE4LHLC2952	YBY3876	2-28-2024	164.60	164.60	replaced trolley harness
	ER34	1FVACYFE4LHLC2952	YBY3876	3-20-2025	0.00	160.00	arm issue arm harness started looking into cover switch inop
	ER34	1FVACYFE4LHLC2952	YBY3876	3-21-2025	0.00	160.00	FIXED ARM THAT WAS INCONSISTENT REPLACED GRABBER CYLINDER AND CHECKED ARM TO MAKE SURE IT OPERATES
	ER34	1FVACYFE4LHLC2952	YBY3876	3-26-2024	0.00	160.00	run new pto wire harness test to see if it cut out after unit pto stayed running
	ER34	1FVACYFE4LHLC2952	YBY3876	4-14-2025	157.90	157.90	FIFINSHED CHAIN REPAIR
	ER34	1FVACYFE4LHLC2952	YBY3876	12-31-2024	0.00	156.00	REPLACED WORK LIGHTS REPLACED BLUE LINE FOR DEF DROVE TO ISTATE TO PICK UP PARTS
	ER34	1FVACYFE4LHLC2952	YBY3876	3-17-2025	154.41	154.41	TILT REBUILD
	ER34	1FVACYFE4LHLC2952	YBY3876	9-11-2024	149.48	149.48	DOUBLE FINGER REPLACE
	ER34	1FVACYFE4LHLC2952	YBY3876	9-6-2024	149.48	149.48	REPLACE FINGER NEED TRANS COOLER LINES TILT LINKAGE
	ER34	1FVACYFE4LHLC2952	YBY3876	7-17-2025	149.10	149.10	ADDED HYDRO AND ATF
	ER34	1FVACYFE4LHLC2952	YBY3876	4-14-2025	0.00	144.00	REPLACED CHAIN
	ER34	1FVACYFE4LHLC2952	YBY3876	2-19-2025	0.00	140.00	HELPED EMISHAW WITH PUTTING TOGETHER NEW FINGERS ON ARM
	ER34	1FVACYFE4LHLC2952	YBY3876	10-24-2024	0.00	140.00	install new harnesses
	ER34	1FVACYFE4LHLC2952	YBY3876	4-26-2024	0.00	140.00	pto kicking out random fix tilt bushing hold down replaced tilt cylinder and clocked hose replaced broken hoses wrapped hoses 4/23 - replaced upper arm hoses. Replaced missing left steer hub plug. Hub fluid looks clear and uncontaminated.
	ER34	1FVACYFE4LHLC2952	YBY3876	3-17-2025	135.72	135.72	REBUILD ARM FIX BLOWER MOTOR
	ER34	1FVACYFE4LHLC2952	YBY3876	5-17-2024	0.00	132.00	Replace o rings on valve blocks and hoses going to valve blocks, replace rubber stop on the side of the body, weld on stops for head
	ER34	1FVACYFE4LHLC2952	YBY3876	4-28-2025	130.76	130.76	REPLACE GRABBER CROSS BAR AND BUSHINGS
	ER34	1FVACYFE4LHLC2952	YBY3876	6-26-2025	0.00	126.00	FINGER BEARING CHANGED FROM 33
	ER34	1FVACYFE4LHLC2952	YBY3876	4-22-2025	0.00	126.00	REPLACE O-RING
	ER34	1FVACYFE4LHLC2952	YBY3876	5-23-2025	0.00	126.00	REPLACE FINGER BUSHINGS
	ER34	1FVACYFE4LHLC2952	YBY3876	10-2-2024	0.00	124.00	SHORTED WIRING
	ER34	1FVACYFE4LHLC2952	YBY3876	2-24-2026	0.00	121.98	INSPECT TRUCK HAVE A LIST OF ISSUES
	ER34	1FVACYFE4LHLC2952	YBY3876	2-16-2024	0.00	120.00	filled coolant and hydro
	ER34	1FVACYFE4LHLC2952	YBY3876	12-16-2024	0.00	120.00	FIX ARM
	ER34	1FVACYFE4LHLC2952	YBY3876	4-16-2024	0.00	120.00	PM Service - 1x lube filter, 2x fuel filters. Greased everything. Fingers are closing too tightly because cylinder connecting part is bent. Will bend out during future visit.
	ER34	1FVACYFE4LHLC2952	YBY3876	4-16-2024	0.00	120.00	PM Service - 1x lube filter, 2x fuel filters. Greased everything. Fingers are closing too tightly because cylinder connecting part is bent. Will bend out during future visit.
	ER34	1FVACYFE4LHLC2952	YBY3876	8-5-2024	0.00	120.00	PULL OFF CRACKED FITTING AND VALVE END REPLACEMENT
	ER34	1FVACYFE4LHLC2952	YBY3876	8-1-2024	0.00	120.00	Put on trolley motor and gear. Didnt have part numbers both need to be entered still
	ER34	1FVACYFE4LHLC2952	YBY3876	3-20-2024	0.00	120.00	Replaced PTO solenoid
	ER34	1FVACYFE4LHLC2952	YBY3876	10-1-2024	0.00	120.00	SORTED WIRING
	ER34	1FVACYFE4LHLC2952	YBY3876	5-15-2025	113.28	113.28	REPALCE DEFECTIVE PARTS
	ER34	1FVACYFE4LHLC2952	YBY3876	3-17-2025	113.28	113.28	REPLACED GRABBER HARNESS

	ER34	1FVACYFE4LHLC2952	YBY3876	4-12-2024	0.00	112.00	Replaced arm harness 4/10 GS - hydro leak from trolley pump control cube. Hydro level not low.
	ER34	1FVACYFE4LHLC2952	YBY3876	12-31-2024	100.69	100.69	REPLACED CRACKED ARM.
	ER34	1FVACYFE4LHLC2952	YBY3876	9-23-2024	0.00	100.00	ORDER PART AND TROUBLE SHOOT
	ER34	1FVACYFE4LHLC2952	YBY3876	9-20-2024	0.00	100.00	FAULT CODES
	ER34	1FVACYFE4LHLC2952	YBY3876	9-20-2024	0.00	100.00	PTO NOT COMING ON BLOWN FUSES IN CAB
	ER34	1FVACYFE4LHLC2952	YBY3876	6-5-2024	0.00	100.00	Truck came in for slow hydro leak and to discuss A/C issues. Drained the Hydro from valve section area. Topped of the hydro tank. (Patrick M. filled the hydro. is entered in Dossier under separate & closed RO case.) GS - Assisted Pirtek with replacement of steel line. Night hydraulic spill cleanup. Service call to truck on route with arm acting up. adjusted arrangement of upper arm hoses. make hoses and replaced leaking ones 6/3 GS & PM Replace missing fuse for PTO. 1x SS part. 6/3 GS & JS service call on route to address overheating hydro system. JS adjusted pack cycle. Waiting to hear from driver/fleet if overheating persists. May need additional hydro coolers. 6/4 - Slow arm speed complaint. Is set to slower to help with overheating hydro issue.
Lot#122	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	11,930.79	11,930.79	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	2,633.60	2,633.60	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	1,872.64	1,872.64	trolley sensor inop rewired to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	4-15-2025	1,562.70	1,562.70	REPLACE SENSOR TROLLEY
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	1,562.70	1,562.70	trolley sensor inop rewired to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	12-16-2021	1,295.00	1,295.00	unit came in with tilt issues . i looked at the arm seen the pilot valve was bad i replaced it with a new one when replacing the new pilot valve for the tilt ope i seen the grabber close pilot valve needed to be replaced as well replaced pilot valve and tilt cylinder and tilt spool . ran arm . arm ran great sent out to route i replaced load runner bearings once i seen how bad they are. replaced tilt cylinder and bent tilt spool calibrated arm . unit worked great sent back out to route
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	989.27	989.27	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	4-19-2024	987.60	987.60	PM Service: 3x hydro, 1x lube, 1x fuel filters. 26qts oil. 18 qts hydro. oil sample taken Rear left brake canister loose. replaced mixing & broken pin collars on double-finger. reattached right side work light. & fixed wiring. Right side back up light needed wire reattached. Used 1 Shop supply. Nut. Engine hours 9081 3030LS brake chamber no price in FM
	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	952.56	952.56	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wired up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	5-20-2024	949.77	949.77	REPLACE AIR DRYER ASSEMBLY TRUCK NOT BUILDING AIR.
	ER35	3ALACYD29LDLW9686	YBY7705	12-16-2021	719.62	719.62	unit came in with tilt issues . i looked at the arm seen the pilot valve was bad i replaced it with a new one when replacing the new pilot valve for the tilt ope i seen the grabber close pilot valve needed to be replaced as well replaced pilot valve and tilt cylinder and tilt spool . ran arm . arm ran great sent out to route i replaced load runner bearings once i seen how bad they are. replaced tilt cylinder and bent tilt spool calibrated arm . unit worked great sent back out to route
	ER35	3ALACYD29LDLW9686	YBY7705	1-24-2025	624.40	624.40	REPLACED CHAIN
	ER35	3ALACYD29LDLW9686	YBY7705	3-19-2026	0.00	601.77	STARTED DOT FIXED LIGHTS NEEDS NEW LUG NUT AND WSS DRIVE LEFT
	ER35	3ALACYD29LDLW9686	YBY7705	3-9-2022	494.24	494.24	truck hit a pole and the gripper fell off we got all the parts to repair and installed new gripper.
	ER35	3ALACYD29LDLW9686	YBY7705	1-9-2024	493.80	493.80	loose wiring to head light
	ER35	3ALACYD29LDLW9686	YBY7705	9-5-2024	486.46	486.46	TROLLEY BANGING
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	486.46	486.46	trolley sensor inop rewired to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	464.40	464.40	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	1-11-2024	464.40	464.40	TOP OFF HYDRAULIC FLUID JE
	ER35	3ALACYD29LDLW9686	YBY7705	9-5-2024	460.11	460.11	TROLLEY BANGING
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	460.11	460.11	trolley sensor inop rewired to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	3-24-2026	440.65	440.65	REPLACED ABS RELAY VALVE