

	ER27	1D92BGGB9LG791012	YBV5865	4-4-2025	0.00	126.00	PM SERVICE
	ER27	1D92BGGB9LG791012	YBV5865	4-25-2025	0.00	126.00	starter motor replaced used
	ER27	1D92BGGB9LG791012	YBV5865	4-8-2025	123.99	123.99	REPLACED FILTERS
	ER27	1D92BGGB9LG791012	YBV5865	5-28-2024	0.00	120.00	5/23 Tighten and replace bolts on finger bushing pins.
	ER27	1D92BGGB9LG791012	YBV5865	3-14-2024	0.00	120.00	5/24 Replace o ring on leaking HP hydro filter, clean threads,
	ER27	1D92BGGB9LG791012	YBV5865	3-14-2024	0.00	120.00	charge air pipe blow off reinstalled
	ER27	1D92BGGB9LG791012	YBV5865	3-14-2024	0.00	120.00	charge air pipe blow off reinstalled
	ER27	1D92BGGB9LG791012	YBV5865	4-26-2024	0.00	120.00	rear door open closed
	ER27	1D92BGGB9LG791012	YBV5865	4-26-2024	0.00	120.00	train driver
	ER27	1D92BGGB9LG791012	YBV5865	11-13-2024	0.00	120.00	REPLACED BLOWER MOTOR SWITCH INSPECT BLOWER MOTOR
	ER27	1D92BGGB9LG791012	YBV5865	8-29-2024	0.00	120.00	SERVICE CALL ARM STUCK
	ER27	1D92BGGB9LG791012	YBV5865	11-1-2024	111.76	111.76	REPLACED GRABBER HARNESS AND TIGHTED STEERING WHEEL
	ER27	1D92BGGB9LG791012	YBV5865	4-4-2025	102.65	102.65	PM SERVICE
	ER27	1D92BGGB9LG791012	YBV5865	8-29-2024	0.00	100.00	SERVICE CALL ARM INOP CART STUCK FREED CART HEAD IN REMOVE SHIRT
Lot#131	ER28	SEG1AKBC1KW025349	YBY6566	12-19-2023	10,567.00	10,567.00	R&R BODY VALVE, OVER PRESSURIZING TROLLEY MOTOR
	ER28	SEG1AKBC1KW025349	YBY6566	2-26-2024	3,292.00	3,292.00	replaced all arm hoses and o-rings replaced tip sensor rewrapped hoses dot fire ex mount installed fire ex replaced fuel leak fixed oil leak fixed fixed finger play
	ER28	SEG1AKBC1KW025349	YBY6566	5-28-2024	1,808.85	1,808.85	body not coming down replaced lift block
	ER28	SEG1AKBC1KW025349	YBY6566	10-22-2024	1,804.43	1,804.43	DEF TANK EMPTY RUN TO KEENDY GET DEF FILL GAUGE SHOWS EMPTY
	ER28	SEG1AKBC1KW025349	YBY6566	4-12-2024	823.00	823.00	Replaced return hydro hose near D1L brake hoses and help Scott with replacing a main hydro hose
	ER28	SEG1AKBC1KW025349	YBY6566	3-14-2024	658.40	658.40	fixed finger bushings and welded braces for straps
	ER28	SEG1AKBC1KW025349	YBY6566	4-26-2024	658.40	658.40	fixed grabber loose and not holding small carts grinder and prep for welding make gussets to fix cracks in arm weld in supports
	ER28	SEG1AKBC1KW025349	YBY6566	12-30-2024	646.66	646.66	arm inop broken cam lever bushing gone
	ER28	SEG1AKBC1KW025349	YBY6566	12-19-2023	573.52	573.52	R&R BODY VALVE, OVER PRESSURIZING TROLLEY MOTOR
	ER28	SEG1AKBC1KW025349	YBY6566	12-19-2023	520.39	520.39	INSTALL MISSING BATTERY BOX COVER
	ER28	SEG1AKBC1KW025349	YBY6566	4-12-2024	329.20	329.20	4/9 Replace zeros on reab body lift hinges
	ER28	SEG1AKBC1KW025349	YBY6566	4-12-2024	329.20	329.20	4/10 tighten chain for trolley, bring outside and raise body so I can check trans fluid and shield hoses from rubbing on body
	ER28	SEG1AKBC1KW025349	YBY6566	2-26-2024	0.00	320.00	replaced all arm hoses and orings replaced tip sensor rewrapped hoses dot fire ex mount installed fire ex replaced fuel leak fixed oil leak fixed fixed finger play
	ER28	SEG1AKBC1KW025349	YBY6566	8-20-2024	305.42	305.42	HYDRO FLUID 170 QTS
	ER28	SEG1AKBC1KW025349	YBY6566	8-16-2024	0.00	260.00	rerouted cooler hoses not installed correctly
	ER28	SEG1AKBC1KW025349	YBY6566	7-10-2025	0.00	252.00	checked wire harness for damage to proxy sensor reconnected harness welded lower hose bracket back onto tro;y josh assisted with prep and staging note looks like driver hit something bracket was bent and fingers bent
	ER28	SEG1AKBC1KW025349	YBY6566	6-30-2025	0.00	252.00	REWIRE ASL HARNESS
	ER28	SEG1AKBC1KW025349	YBY6566	12-31-2024	218.22	218.22	TROUBLE SHOOT REPLACED CLEANED PARTS OUT REPLACED DIFF SENSORS
	ER28	SEG1AKBC1KW025349	YBY6566	10-22-2024	0.00	212.00	DEF TANK EMPTY RUN TO KEENDY GET DEF FILL GAUGE SHOWS EMPTY
	ER28	SEG1AKBC1KW025349	YBY6566	4-9-2024	206.39	206.39	PM Service JE - jumpstart in AM GS- fuel, oil, & hydro filters + oil sample. 19qts 15w40 *needs oil level check* JS - Looked over everything PM -
	ER28	SEG1AKBC1KW025349	YBY6566	11-11-2024	206.39	206.39	TEST FOUND PUMP FALED NEEDS TO BE REPLACED NEED INVOICE FOR WARRENTY
	ER28	SEG1AKBC1KW025349	YBY6566	4-12-2024	0.00	200.00	4/9 Did a pm except George did wet portion. 1st drive diff output seal leaks despite clear breather and no shaft play, topped up, needs to be watched. Windows wont go up 100% but josh says it cant be fixed. needs top of arm greased, hydro checked, trans fluid checked. looked over 4/10 Finished up PM by greasing top of arm, checked hydron fluid, checked trans fluid
	ER28	SEG1AKBC1KW025349	YBY6566	8-16-2024	0.00	200.00	PULL PUMP OUT MOVE WIRING TO GET AT BOLTS
	ER28	SEG1AKBC1KW025349	YBY6566	11-22-2024	0.00	200.00	REPLACED WARRENTY PUMP
	ER28	SEG1AKBC1KW025349	YBY6566	5-21-2025	0.00	189.00	FIX TILT AND PIN LOOSE AND FINGERS
	ER28	SEG1AKBC1KW025349	YBY6566	8-6-2024	0.00	180.00	BUILT HYDRO COOLER FRAME

	ER28	SEG1AKBC1KW025349	YBY6566	4-26-2024	0.00	180.00	fixed grabber loose and not holding small carts grinde and prep for welding make gussets to fix cracks in arm weld in supports
	ER28	SEG1AKBC1KW025349	YBY6566	3-13-2025	0.00	180.00	REWIRE SIP MID SHIP LIGHT HARNESSSHORTED GET PART
	ER28	SEG1AKBC1KW025349	YBY6566	12-31-2024	176.40	176.40	TROUBLE SHOOT REPLACED CLEANED PARTS OUT REPLACED DIFF SENSORS
	ER28	SEG1AKBC1KW025349	YBY6566	8-19-2024	0.00	172.00	INSTALLED NEW SEALS IN PTO AND REINSTALLED NEW PUMP PUMP SOLONOID JOYSTICK
	ER28	SEG1AKBC1KW025349	YBY6566	4-12-2024	164.60	164.60	4/9 Did a pm except george did wet portion. 1st drive diff output seal leaks despite clear breather and no shaft play, topped up, needs to be watched. Windows wont go up 100% but josh says it cant be fixed. needs top of arm greased, hydro checked, trans fluid checked. looked over 4/10 Finished up PM by greasing top of arm, checked hydron fluid, checked trans fluid
	ER28	SEG1AKBC1KW025349	YBY6566	4-26-2024	164.60	164.60	air fitting broke off replaced and angled replaced fitting and rerouted so it wouldn't get hit
	ER28	SEG1AKBC1KW025349	YBY6566	5-28-2024	164.60	164.60	body not coming down replaced lift block
	ER28	SEG1AKBC1KW025349	YBY6566	4-17-2024	164.60	164.60	D1L service hose broke off at double male nipple on chamber, replace and test. OK
	ER28	SEG1AKBC1KW025349	YBY6566	1-24-2024	164.60	164.60	lights out replaced
	ER28	SEG1AKBC1KW025349	YBY6566	1-29-2024	164.60	164.60	replaced pin on finger
	ER28	SEG1AKBC1KW025349	YBY6566	4-5-2024	164.60	164.60	shut battery switch off
	ER28	SEG1AKBC1KW025349	YBY6566	3-29-2024	164.60	164.60	truck no dumping got it to dump and brought to the shop replaced dump valve silinoid tested working returned to yard
	ER28	SEG1AKBC1KW025349	YBY6566	1-24-2024	164.60	164.60	when out to 28arm not moving checked all systems found relay bad got it to work but on the way it quit returned to 28 and fix had driver bring it in for repairs cleaned terminals and replaced relay tested
	ER28	SEG1AKBC1KW025349	YBY6566	4-26-2024	0.00	160.00	air fitting broke off replaced and angled replaced fitting and rerouted so it wouldn't get hit
	ER28	SEG1AKBC1KW025349	YBY6566	5-28-2024	0.00	160.00	body not coming down replaced lift block
	ER28	SEG1AKBC1KW025349	YBY6566	7-10-2025	0.00	160.00	checked wire harness for damage to proxy sensor reconnected harness welded lower hose bracket back onto tro;y josh assisted with prep and staging note looks like driver hit something bracket was bent and fingers bent
	ER28	SEG1AKBC1KW025349	YBY6566	4-9-2024	0.00	160.00	PM Service JE - jumpstart in AM GS- fuel, oil, & hydro filters + oil sample. 19qts 15w40 *needs oil level check* JS - Looked over everything PM -
	ER28	SEG1AKBC1KW025349	YBY6566	8-15-2024	0.00	160.00	testing started pulling pump
	ER28	SEG1AKBC1KW025349	YBY6566	1-24-2024	0.00	160.00	when out to 28arm not moving checked all systems found relay bad got it to work but on the way it quit returned to 28 and fix had driver bring it in for repairs cleaned terminals and replaced relay tested
	ER28	SEG1AKBC1KW025349	YBY6566	4-1-2025	149.48	149.48	claw fingers
	ER28	SEG1AKBC1KW025349	YBY6566	7-17-2025	149.48	149.48	REPLACE CLAW PART
	ER28	SEG1AKBC1KW025349	YBY6566	2-26-2025	0.00	140.00	BRAKE LIGHTS ABS FIXED WIRES WITH MOHAMED
	ER28	SEG1AKBC1KW025349	YBY6566	1-27-2025	0.00	140.00	PULL GRABBER OFF FOR REBUILD
	ER28	SEG1AKBC1KW025349	YBY6566	8-7-2024	0.00	132.00	FINISH HYDRO COOLER NAPA FOR MORE PAINT
	ER28	SEG1AKBC1KW025349	YBY6566	6-4-2025	0.00	126.00	ARM GRABBER NOT WORKING SLAMMING PROGRAM
	ER28	SEG1AKBC1KW025349	YBY6566	3-13-2026	0.00	126.00	TEST DRIVE WITH KIRK
	ER28	SEG1AKBC1KW025349	YBY6566	9-9-2025	0.00	126.00	WIPERS INOP PICK UP PARTS
	ER28	SEG1AKBC1KW025349	YBY6566	2-26-2025	0.00	120.00	BRAKE LIGHTS ABS FIXED WIRES WITH MOHAMED
	ER28	SEG1AKBC1KW025349	YBY6566	3-12-2025	0.00	120.00	DOT FAILED NEEDS PARTS HUB CAP AND WIRING FOR SIDE MARKER LIGHTS
	ER28	SEG1AKBC1KW025349	YBY6566	9-24-2024	0.00	120.00	FINISHED 2 TROLLY PREP REPLACED CALAIBRATION
	ER28	SEG1AKBC1KW025349	YBY6566	12-12-2024	0.00	120.00	FIX GRABBER HAND WELD AND STAIGHTEN
	ER28	SEG1AKBC1KW025349	YBY6566	3-14-2024	0.00	120.00	fixed finger bushings and welded braces for straps
	ER28	SEG1AKBC1KW025349	YBY6566	10-9-2024	0.00	120.00	INSPECTED BREAK ON FRAME TROLLY SENSOR NOT MOUNTED WELL TACKED SERV NUTS CALABRATED ADJUSTED
	ER28	SEG1AKBC1KW025349	YBY6566	11-6-2024	0.00	120.00	REWIRE PTO AND CAM WIRING AS WELL AS COMPUTR HARNESS
	ER28	SEG1AKBC1KW025349	YBY6566	12-31-2024	0.00	120.00	TROUBLE SHOOT REPLACED CLEANED PARTS OUT REPLACED DIFF SENSORS
	ER28	SEG1AKBC1KW025349	YBY6566	3-29-2024	0.00	120.00	truck no dumping got it to dump and brought to the shop replaced dump valve silinoid tested working returned to yard
	ER28	SEG1AKBC1KW025349	YBY6566	10-9-2024	0.00	120.00	won't grab cans
	ER28	SEG1AKBC1KW025349	YBY6566	1-24-2024	113.26	113.26	lights out replaced
	ER28	SEG1AKBC1KW025349	YBY6566	12-13-2024	102.65	102.65	CHANGED FUEL WATER SEPERATOR
	ER28	SEG1AKBC1KW025349	YBY6566	4-12-2024	0.00	100.00	4/9 Replace zercs on reab body lift hinges 4/10 tighten chain for trolley, bring outside and raise body so I can check trans fluid and shield hoses from rubbing on body
	ER28	SEG1AKBC1KW025349	YBY6566	8-21-2024	0.00	100.00	ADJUST PRESSURE FIXED PACKER SHOES INSTALLED WASHER TANK AND WIRE FOR MACK PLUG MACK WASHER TANK AND PIGTAIL FLEETPRIDE

	ER28	SEG1AKBC1KW025349	YBY6566	11-7-2024	0.00	100.00	FINISH WIRING
	ER28	SEG1AKBC1KW025349	YBY6566	6-4-2024	0.00	100.00	Replace all 3 batteries. Had to pick them up at fleet pride
	ER28	SEG1AKBC1KW025349	YBY6566	4-12-2024	0.00	100.00	Replaced return hydro hose near D1L brake hoses and help Scott with replacing a main hydro hose
	ER28	SEG1AKBC1KW025349	YBY6566	11-11-2024	0.00	100.00	TEST FOUND PUMP FALED NEEDS TO BE REPLACED NEED INVOICE FOR WARRENTY
Lot#120	ER32	1FVACYFE2LHLC2951	YBY3874	4-26-2024	8,230.00	8,230.00	Replaced hydraulic hoses on arm 4/12 GS - replaced hydraulic hoses on upper arm. 12 fittings, 6 hoses, & 1 o-ring. 4/17 GS - Replaced 1 broken snapped finger, bent other finger back in place. Replaced 2 backing bars. (1 missing, one snapped off) hopper cover not open
	ER32	1FVACYFE2LHLC2951	YBY3874	3-4-2026	1,991.77	1,991.77	installed reach cylinder
	ER32	1FVACYFE2LHLC2951	YBY3874	3-25-2026	1,737.28	1,737.28	DIAG REACH CYLINDER
	ER32	1FVACYFE2LHLC2951	YBY3874	1-23-2025	1,690.16	1,690.16	R&R REACH CYLINDER
	ER32	1FVACYFE2LHLC2951	YBY3874	3-19-2025	1,690.16	1,690.16	REINSTALL HARNESS
	ER32	1FVACYFE2LHLC2951	YBY3874	5-2-2022	1,562.70	1,562.70	replaced sensor and trolley motor transducer
	ER32	1FVACYFE2LHLC2951	YBY3874	4-23-2024	1,562.70	1,562.70	Trolley position sensor, replace
	ER32	1FVACYFE2LHLC2951	YBY3874	4-27-2022	1,389.64	1,389.64	replaced all drives. torqued lug nuts to 500ft-lbs
	ER32	1FVACYFE2LHLC2951	YBY3874	3-12-2024	1,152.20	1,152.20	resealed valve body cleaned drained side tank part parker seal kit 393000k871
	ER32	1FVACYFE2LHLC2951	YBY3874	1-20-2025	1,149.99	1,149.99	arm banging and jerky replaced reach harness upon running radiator decide to burst R&R radiator
	ER32	1FVACYFE2LHLC2951	YBY3874	11-1-2021	915.70	915.70	replaced steer tires.
	ER32	1FVACYFE2LHLC2951	YBY3874	3-22-2024	908.58	908.58	parts bill out and drop off at boyer
	ER32	1FVACYFE2LHLC2951	YBY3874	4-26-2024	823.00	823.00	find short and fix wires to side marker light 4/11 headlight high-beam replacement. Used 1 part. 4/17 - Bubble work light replacement. 4 SS parts used for deutsche plug
	ER32	1FVACYFE2LHLC2951	YBY3874	4-29-2025	0.00	622.80	INSTALL PRESSURE REILF VALVE
	ER32	1FVACYFE2LHLC2951	YBY3874	2-22-2024	559.98	559.98	filled tranny filled hyro adjusted brakes Replaced trans cooler lines
	ER32	1FVACYFE2LHLC2951	YBY3874	1-22-2025	469.56	469.56	ARM LOSING CALAIBRATION RANGE LOW ERROR REPLACED HARNESS ARM REACH ON RETRACT GOES TO ZERO 2 FEET AWAY BODY THEN LOSS UPTIGHT NEED REACH CYLINDER PART ORDERED
	ER32	1FVACYFE2LHLC2951	YBY3874	3-14-2025	469.56	469.56	BACK OFF PACKER PRESSURE WAS OVER HEATING
	ER32	1FVACYFE2LHLC2951	YBY3874	3-19-2025	469.56	469.56	REINSTALL HARNESS
	ER32	1FVACYFE2LHLC2951	YBY3874	2-5-2025	469.56	469.56	Replaced Arm Harness
	ER32	1FVACYFE2LHLC2951	YBY3874	12-24-2024	460.11	460.11	arm harness pulled apart and replaced
	ER32	1FVACYFE2LHLC2951	YBY3874	12-24-2024	460.11	460.11	harness RIPPED APART
	ER32	1FVACYFE2LHLC2951	YBY3874	3-7-2024	453.02	453.02	arm inop went and found broken wires stowed it came to the shop replaced arm harness
	ER32	1FVACYFE2LHLC2951	YBY3874	4-23-2024	453.02	453.02	replaced fingers 4/23 replaced tilt sensor cable, test drive, checked codes, replaced arm wire harness.
	ER32	1FVACYFE2LHLC2951	YBY3874	4-26-2024	453.02	453.02	Replaced hydraulic hoses on arm 4/12 GS - replaced hydraulic hoses on upper arm. 12 fittings, 6 hoses, & 1 o-ring. 4/17 GS - Replaced 1 broken snapped finger, bent other finger back in place. Replaced 2 backing bars. (1 missing, one snapped off) hopper cover not open
	ER32	1FVACYFE2LHLC2951	YBY3874	4-16-2025	432.23	432.23	tubes cpr water pump fuel transfer
	ER32	1FVACYFE2LHLC2951	YBY3874	11-5-2024	425.35	425.35	REWIRED
	ER32	1FVACYFE2LHLC2951	YBY3874	4-16-2024	329.20	329.20	seal trans crack inside casing filled
	ER32	1FVACYFE2LHLC2951	YBY3874	3-21-2022	322.87	322.87	replaced hose and bracket that holds both side of the claws together. I don't know the part#
	ER32	1FVACYFE2LHLC2951	YBY3874	1-20-2025	0.00	320.00	arm banging and jerky replaced reach harness upon running radiator decide to burst R&R radiator
	ER32	1FVACYFE2LHLC2951	YBY3874	4-7-2026	0.00	315.00	WIRE HARNESS DIAG.
	ER32	1FVACYFE2LHLC2951	YBY3874	3-27-2025	0.00	300.00	REMOVE FUEL LINES AND GRID HATER ANFD THE OLD GASKET
	ER32	1FVACYFE2LHLC2951	YBY3874	4-26-2024	298.96	298.96	Replaced hydraulic hoses on arm 4/12 GS - replaced hydraulic hoses on upper arm. 12 fittings, 6 hoses, & 1 o-ring. 4/17 GS - Replaced 1 broken snapped finger, bent other finger back in place. Replaced 2 backing bars. (1 missing, one snapped off) hopper cover not open
	ER32	1FVACYFE2LHLC2951	YBY3874	3-4-2026	0.00	288.00	installed reach cylinder
	ER32	1FVACYFE2LHLC2951	YBY3874	12-30-2021	286.11	286.11	driver bent double fingers. I replaced assembly
	ER32	1FVACYFE2LHLC2951	YBY3874	4-16-2025	0.00	280.80	tubes cpr water pump fuel transfer
	ER32	1FVACYFE2LHLC2951	YBY3874	5-1-2025	0.00	270.00	LOOK FOR LEAKS IN THE FUEL LINES
	ER32	1FVACYFE2LHLC2951	YBY3874	2-22-2024	258.00	258.00	filled tranny filled hyro adjusted brakes Replaced trans cooler lines
	ER32	1FVACYFE2LHLC2951	YBY3874	4-13-2026	0.00	252.00	wiring
	ER32	1FVACYFE2LHLC2951	YBY3874	2-16-2024	0.00	240.00	Patched floor of ER32
	ER32	1FVACYFE2LHLC2951	YBY3874	2-16-2024	0.00	240.00	Patched floor of ER32
	ER32	1FVACYFE2LHLC2951	YBY3874	4-26-2024	0.00	240.00	replaced both engine speed sensors
	ER32	1FVACYFE2LHLC2951	YBY3874	6-25-2024	238.14	238.14	TROLLEY TIP WAS OFF, RECALIBRATED SETTINGS. JE REPLACED ROLLERS, AND TIGHTEN UP CHAIN