

	ER34	1FVACYFE4LHLC2952	YBY3876	4-12-2024	0.00	112.00	Replaced arm harness 4/10 GS - hydro leak from trolley pump control cube. Hydro level not low.
	ER34	1FVACYFE4LHLC2952	YBY3876	12-31-2024	100.69	100.69	REPLACED CRACKED ARM.
	ER34	1FVACYFE4LHLC2952	YBY3876	9-23-2024	0.00	100.00	ORDER PART AND TROUBLE SHOOT
	ER34	1FVACYFE4LHLC2952	YBY3876	9-20-2024	0.00	100.00	FAULT CODES
	ER34	1FVACYFE4LHLC2952	YBY3876	9-20-2024	0.00	100.00	PTO NOT COMING ON BLOWN FUSES IN CAB
	ER34	1FVACYFE4LHLC2952	YBY3876	6-5-2024	0.00	100.00	Truck came in for slow hydro leak and to discuss A/C issues. Drained the Hydro from valve section area. Topped of the hydro tank. (Patrick M. filled the hydro. is entered in Dossier under separate & closed RO case.) GS - Assisted Pirtek with replacement of steel line. Night hydraulic spill cleanup. Service call to truck on route with arm acting up. adjusted arrangement of upper arm hoses. make hoses and replaced leaking ones 6/3 GS & PM Replace missing fuse for PTO. 1x SS part. 6/3 GS & JS service call on route to address overheating hydro system. JS adjusted pack cycle. Waiting to hear from driver/fleet if overheating persists. May need additional hydro coolers. 6/4 - Slow arm speed complaint. Is set to slower to help with overheating hydro issue.
Lot#122	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	11,930.79	11,930.79	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	2,633.60	2,633.60	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	1,872.64	1,872.64	trolley sensor inop rewired to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	4-15-2025	1,562.70	1,562.70	REPLACE SENSOR TROLLEY
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	1,562.70	1,562.70	trolley sensor inop rewired to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	12-16-2021	1,295.00	1,295.00	unit came in with tilt issues . i looked at the arm seen the pilot valve was bad i replaced it with a new one when replacing the new pilot valve for the tilt ope i seen the grabber close pilot valve needed to be replaced as well replaced pilot valve and tilt cylinder and tilt spool . ran arm . arm ran great sent out to route i replaced load runner bearings once i seen how bad they are. replaced tilt cylinder and bent tilt spool calibrated arm . unit worked great sent back out to route
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	989.27	989.27	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	4-19-2024	987.60	987.60	PM Service: 3x hydro, 1x lube, 1x fuel filters. 26qts oil. 18 qts hydro. oil sample taken Rear left brake canister loose. replaced mixing & broken pin collars on double-finger. reattached right side work light. & fixed wiring. Right side back up light needed wire reattached. Used 1 Shop supply. Nut. Engine hours 9081 3030LS brake chamber no price in FM
	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	952.56	952.56	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wired up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	5-20-2024	949.77	949.77	REPLACE AIR DRYER ASSEMBLY TRUCK NOT BUILDING AIR.
	ER35	3ALACYD29LDLW9686	YBY7705	12-16-2021	719.62	719.62	unit came in with tilt issues . i looked at the arm seen the pilot valve was bad i replaced it with a new one when replacing the new pilot valve for the tilt ope i seen the grabber close pilot valve needed to be replaced as well replaced pilot valve and tilt cylinder and tilt spool . ran arm . arm ran great sent out to route i replaced load runner bearings once i seen how bad they are. replaced tilt cylinder and bent tilt spool calibrated arm . unit worked great sent back out to route
	ER35	3ALACYD29LDLW9686	YBY7705	1-24-2025	624.40	624.40	REPLACED CHAIN
	ER35	3ALACYD29LDLW9686	YBY7705	3-19-2026	0.00	601.77	STARTED DOT FIXED LIGHTS NEEDS NEW LUG NUT AND WSS DRIVE LEFT
	ER35	3ALACYD29LDLW9686	YBY7705	3-9-2022	494.24	494.24	truck hit a pole and the gripper fell off we got all the parts to repair and installed new gripper.
	ER35	3ALACYD29LDLW9686	YBY7705	1-9-2024	493.80	493.80	loose wiring to head light
	ER35	3ALACYD29LDLW9686	YBY7705	9-5-2024	486.46	486.46	TROLLEY BANGING
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	486.46	486.46	trolley sensor inop rewired to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	464.40	464.40	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	1-11-2024	464.40	464.40	TOP OFF HYDRAULIC FLUID JE
	ER35	3ALACYD29LDLW9686	YBY7705	9-5-2024	460.11	460.11	TROLLEY BANGING
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	460.11	460.11	trolley sensor inop rewired to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	3-24-2026	440.65	440.65	REPLACED ABS RELAY VALVE

	ER35	3ALACYD29LDLW9686	YBY7705	1-18-2024	325.08	325.08	not building air found tanks frozen heated and then drained filled hydro fluid checked abs no issue found
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	0.00	320.00	installed cooler and hoses replaced 190 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	1-25-2024	309.60	309.60	fixed window filled hydro
	ER35	3ALACYD29LDLW9686	YBY7705	1-25-2024	309.60	309.60	filled tank
	ER35	3ALACYD29LDLW9686	YBY7705	2-27-2024	309.60	309.60	filled tank regen
	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	304.00	304.00	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wirred up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	11-29-2021	286.11	286.11	single finger was bent replaced finger arm was in good shape
	ER35	3ALACYD29LDLW9686	YBY7705	6-10-2025	284.88	284.88	hydro hose misssing claw boltreplace degree roller
	ER35	3ALACYD29LDLW9686	YBY7705	8-9-2022	284.87	284.87	replaced trolly runner. couldnt find part number in the system.#96220 or#flry-3. Put new idler shaft in it
	ER35	3ALACYD29LDLW9686	YBY7705	1-25-2024	283.80	283.80	filled tank
	ER35	3ALACYD29LDLW9686	YBY7705	11-13-2024	0.00	280.00	INSTALL ARM ON BASE
	ER35	3ALACYD29LDLW9686	YBY7705	3-26-2026	0.00	264.29	DOT
	ER35	3ALACYD29LDLW9686	YBY7705	3-14-2022	258.33	258.33	truck cam in with the pto keeps shutting off. i topped off the hyd tank and tried it but still cut out when running the arm. i found a relay behind the seat that was getting hot. still cutting out. called pactech and chased down the wire from the pto to cab and found a loose connector under the cab. truck is running good now.
	ER35	3ALACYD29LDLW9686	YBY7705	4-19-2024	0.00	256.00	PM Service: 3x hydro, 1x lube, 1x fuel filters. 26qts oil. 18 qts hydro. oil sample taken Rear left brake canister loose. replaced mixing & broken pin collars on double-finger. reattached right side work light. & fixed wiring. Right side back up light needed wire reattached. Used 1 Shop supply. Nut. Engine hours 9081 3030LS brake chamber no price in FM
	ER35	3ALACYD29LDLW9686	YBY7705	12-16-2021	248.76	248.76	unite came in with tilt issues . i looked at the arm seen the pilot valve was bad i replaced it with a new one when replacing the new pilot valve for the tilt ope i seen the grabber close pilot valve needed to be replaced as well replaced pilot vavle and tilt cylinder and tilt spoil . ran arm . arm ran great sent out to route i replaced load runner bearings once i seen how bad they are. replaced tilt cylinder and bent tilt spoilie calbrated arm . unite worked great sent back out to route
	ER35	3ALACYD29LDLW9686	YBY7705	9-2-2022	247.00	247.00	missing wheel cap for wheel bearing oil. filled it with gear oil, replaced cap, and checked for play. it was good. filled hydro with 25 qts. replaced headlight. headlight is working intermittently. possible bad wire. will have to follow up on it
	ER35	3ALACYD29LDLW9686	YBY7705	5-16-2024	238.14	238.14	Replace missing pin bushing and bottom plate on double finger. 5/14 GS & JS - trolley rollers replacement - 5/16 - finger pin bushing replacement. used 2x bolts from shop supply.
	ER35	3ALACYD29LDLW9686	YBY7705	2-22-2022	237.00	237.00	THERE WAS A GOOD HYD LEAK IN THE SIDE BOX. TIGHTENED UP JAM NUT AND RAN TRUCK. NO MORE LEAKS AT THIS TIME. I ALSO TOPPED OFF TRUCK.
	ER35	3ALACYD29LDLW9686	YBY7705	3-26-2026	0.00	235.83	FOUND ISSUE MAY HAVE BEEN PINCHED OR LOOSE CONNECTION AT ODOMETER OF CHASIS HARNENSS ABS LIGHT CLEARED PASSED DOT
	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	222.88	222.88	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wirred up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	12-16-2021	218.08	218.08	unite came in with tilt issues . i looked at the arm seen the pilot valve was bad i replaced it with a new one when replacing the new pilot valve for the tilt ope i seen the grabber close pilot valve needed to be replaced as well replaced pilot vavle and tilt cylinder and tilt spoil . ran arm . arm ran great sent out to route i replaced load runner bearings once i seen how bad they are. replaced tilt cylinder and bent tilt spoilie calbrated arm . unite worked great sent back out to route
	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	214.20	214.20	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wirred up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	8-15-2024	207.49	207.49	8/13 FINGER REPAIR LEAKING HOSE PIRTEK REPAIR 8/12 REPLACE HOOD LATCH 8/12 ASSIST PIRTEK 8/14 WINDOW REGULATOR INSTALL
	ER35	3ALACYD29LDLW9686	YBY7705	1-9-2024	206.40	206.40	TOP OFF HYDRAULIC FLUID JE
	ER35	3ALACYD29LDLW9686	YBY7705	9-5-2024	0.00	200.00	TROLLY BANGING

	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	199.20	199.20	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wirred up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	6-4-2025	198.53	198.53	GRIPPER FINGERS CLAW
	ER35	3ALACYD29LDLW9686	YBY7705	12-2-2021	184.00	184.00	there was a leak coming from this units roll up door . i seen a leak on lower main hard hose.the leak was from a loose hydro fitting i tightned it ran arm and body no leak seen .
	ER35	3ALACYD29LDLW9686	YBY7705	11-18-2024	0.00	180.00	completed pm oil change
	ER35	3ALACYD29LDLW9686	YBY7705	4-19-2024	168.15	168.15	PM Service: 3x hydro, 1x lube, 1x fuel filters. 26qts oil. 18 qts hydro. oil sample taken Rear left brake canister loose. replaced mixing & broken pin collars on double-finger. reattached right side work light. & fixed wiring. Right side back up light needed wire reattached. Used 1 Shop supply. Nut. Engine hours 9081 3030LS brake chamber no price in FM
	ER35	3ALACYD29LDLW9686	YBY7705	5-16-2024	168.15	168.15	Replace missing pin bushing and bottom plate on double finger. 5/14 GS & JS - trolley rollers replacement - 5/16 - finger pin bushing replacement. used 2x bolts from shop supply.
	ER35	3ALACYD29LDLW9686	YBY7705	3-16-2022	165.90	165.90	filled hydro tank
	ER35	3ALACYD29LDLW9686	YBY7705	3-10-2022	165.90	165.90	truck came in and was leaking from the gripper.I had to replace an oring but it was in a tight spot so i had to make a tool to get it out. replaced it and topped off tank.
	ER35	3ALACYD29LDLW9686	YBY7705	1-25-2024	164.60	164.60	fixed window filled hydro
	ER35	3ALACYD29LDLW9686	YBY7705	4-26-2024	164.60	164.60	arm inop rear door not closed
	ER35	3ALACYD29LDLW9686	YBY7705	3-26-2024	164.60	164.60	arm stopping rear door was open
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	164.60	164.60	check and adjust brakes
	ER35	3ALACYD29LDLW9686	YBY7705	2-27-2024	164.60	164.60	filled tank regen
	ER35	3ALACYD29LDLW9686	YBY7705	1-18-2024	164.60	164.60	not building air found tanks frozen heated and then drained filled hydro fluid checked abs no issue found
	ER35	3ALACYD29LDLW9686	YBY7705	3-19-2024	164.60	164.60	not building air tanks frozen full of water replaced cartridge filled tank with shop air still not releasing
	ER35	3ALACYD29LDLW9686	YBY7705	3-14-2024	164.60	164.60	Replace grabber hydraulic hose, 2 orings, fill up 20qts hydro
	ER35	3ALACYD29LDLW9686	YBY7705	5-16-2024	164.60	164.60	Replace missing pin bushing and bottom plate on double finger. 5/14 GS & JS - trolley rollers replacement - 5/16 - finger pin bushing replacement. used 2x bolts from shop supply.
	ER35	3ALACYD29LDLW9686	YBY7705	2-26-2024	164.60	164.60	replaced leaking fitting and oring filled hyro
	ER35	3ALACYD29LDLW9686	YBY7705	4-5-2024	164.60	164.60	Replaced lower bearing on double finger pin, tightened finger bolts on single finger side
	ER35	3ALACYD29LDLW9686	YBY7705	3-12-2024	164.60	164.60	shutting down found bad coolant level sensor will need to be replaced
	ER35	3ALACYD29LDLW9686	YBY7705	2-24-2025	164.01	164.01	replaced all hydro lines on arm that were leaking . filled up truck with hydro
	ER35	3ALACYD29LDLW9686	YBY7705	3-20-2026	0.00	162.64	REPLACED WSS NEEDS HARNESS TO MOUDULATOR
	ER35	3ALACYD29LDLW9686	YBY7705	2-8-2024	0.00	160.00	installed cooler and hoses replaced I90 valve replaced arm hose adjusted arm
	ER35	3ALACYD29LDLW9686	YBY7705	1-18-2024	0.00	160.00	not building air found tanks frozen heated and then drained filled hydro fluid checked abs no issue found
	ER35	3ALACYD29LDLW9686	YBY7705	4-19-2024	0.00	160.00	PM Service: 3x hydro, 1x lube, 1x fuel filters. 26qts oil. 18 qts hydro. oil sample taken Rear left brake canister loose. replaced mixing & broken pin collars on double-finger. reattached right side work light. & fixed wiring. Right side back up light needed wire reattached. Used 1 Shop supply. Nut. Engine hours 9081 3030LS brake chamber no price in FM
	ER35	3ALACYD29LDLW9686	YBY7705	5-20-2024	0.00	160.00	REPLACE AIR DRYER ASSEMBLY TRUCK NOT BUILDING AIR.
	ER35	3ALACYD29LDLW9686	YBY7705	11-19-2024	0.00	160.00	trolly sensor inop rewire to module and replace tilt cylinder
	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	155.18	155.18	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wirred up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	4-19-2024	154.41	154.41	PM Service: 3x hydro, 1x lube, 1x fuel filters. 26qts oil. 18 qts hydro. oil sample taken Rear left brake canister loose. replaced mixing & broken pin collars on double-finger. reattached right side work light. & fixed wiring. Right side back up light needed wire reattached. Used 1 Shop supply. Nut. Engine hours 9081 3030LS brake chamber no price in FM
	ER35	3ALACYD29LDLW9686	YBY7705	5-16-2024	152.31	152.31	Replace missing pin bushing and bottom plate on double finger. 5/14 GS & JS - trolley rollers replacement - 5/16 - finger pin bushing replacement. used 2x bolts from shop supply.

	ER35	3ALACYD29LDLW9686	YBY7705	8-28-2024	0.00	152.00	HYDRO LEAK HAD TO COME BACK MAKE HOSES AND RUN BACK OUT INSTALL AND CLEAN UP
	ER35	3ALACYD29LDLW9686	YBY7705	8-28-2024	0.00	152.00	HYDRO LEAK HAD TO COME BACK MAKE HOSES AND RUN BACK OUT INSTALL AND CLEAN UP
	ER35	3ALACYD29LDLW9686	YBY7705	3-9-2022	142.20	142.20	truck has a big leak under it went out to him and did not have the right stuff to repair due to the size of the hose. i called pertek and thay made the repair and i cleaned up the mess.
	ER35	3ALACYD29LDLW9686	YBY7705	12-21-2021	139.14	139.14	bulkhead module was blowing fuses on f7.F20F22 head was also cracked needed to be taken off and repaired. repair 1) took off grabber head from trolley frame /mount . started to take off all parts . replaced grabber pivot bolt and nut for left side of grabber . replaced grip cyl keeper pin , both baerings and bearing seal's
	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	139.14	139.14	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wirred up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	11-18-2024	122.50	122.50	completed pm oil change
	ER35	3ALACYD29LDLW9686	YBY7705	11-13-2024	0.00	120.00	INSTALL ARM ON BASE
	ER35	3ALACYD29LDLW9686	YBY7705	3-19-2024	0.00	120.00	not building air tanks frozen full of water replaced cartridge filled tank with shop air still not releasing
	ER35	3ALACYD29LDLW9686	YBY7705	11-18-2024	116.47	116.47	completed pm oil change
	ER35	3ALACYD29LDLW9686	YBY7705	5-20-2024	109.99	109.99	REPLACE AIR DRYER ASSEMBLY TRUCK NOT BUILDING AIR.
	ER35	3ALACYD29LDLW9686	YBY7705	6-4-2025	106.39	106.39	GRIPPER FINGERS CLAW
	ER35	3ALACYD29LDLW9686	YBY7705	2-24-2025	0.00	100.00	replaced all hydro lines on arm that were leaking . filled up truck with hydro
Lot#123	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	11,073.54	11,073.54	replaced trolly asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	9-1-2022	10,567.00	10,567.00	L90 VALVE IS LEAKING BAD IN SIDE CABNET. REPLACED VALVE. ALSO REPLACED REACH CYLINDER
	ER36	3ALACYD20LDLW9687	YBY7704	4-11-2024	2,962.80	2,962.80	Replaced leaking hydro hose on arm, added 22qts hydro fluid, cleaned up excess from leak.
	ER36	3ALACYD20LDLW9687	YBY7704	1-18-2022	2,859.89	2,859.89	unit came in with ope issues with the arm the joystick not working(the active trigger was droken) i replaced it with a new one . i tested the arm and joystick everything worked great . i sent the unit back out to route
	ER36	3ALACYD20LDLW9687	YBY7704	9-1-2022	1,690.15	1,690.15	L90 VALVE IS LEAKING BAD IN SIDE CABNET. REPLACED VALVE. ALSO REPLACED REACH CYLINDER
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	1,648.86	1,648.86	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	2-24-2022	1,431.04	1,431.04	replaced trolly transducer
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	1,112.75	1,112.75	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	823.00	823.00	replaced trolly asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	786.85	786.85	replaced trolly asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	7-25-2024	658.40	658.40	Replace supply side hydro side valve o rings, add hydro
	ER36	3ALACYD20LDLW9687	YBY7704	7-22-2025	0.00	546.00	HOSE LEAK
	ER36	3ALACYD20LDLW9687	YBY7704	5-10-2024	493.80	493.80	CLAW INOP, R&R GRABBER HARNESS OK FLUID LEAK HOSE MADE BY PIRTEK replaced seat
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2022	476.28	476.28	replaced all 4 rollers on gripper. also topped off hyd tank.
	ER36	3ALACYD20LDLW9687	YBY7704	3-10-2025	469.56	469.56	TILT NOT WORKING FOUND LOOSE WIRE REPAIRED
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	453.02	453.02	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	7-3-2025	0.00	450.00	BLOWER MOTOR FUSE
	ER36	3ALACYD20LDLW9687	YBY7704	7-27-2022	336.00	336.00	replaced hydraulic hose going to the packer cylinder. filled hydro tank
	ER36	3ALACYD20LDLW9687	YBY7704	1-13-2025	321.66	321.66	REPAIR PSCI CODE PULL PAN DOWN REPLACE PSC SOENOID HARNESS NEW FILTER