

	ER36	3ALACYD20LDLW9687	YBY7704	1-9-2024	152.31	152.31	finger bushings broken replaced
	ER36	3ALACYD20LDLW9687	YBY7704	4-26-2024	0.00	152.00	PM service. 2x fuel filters, 3x hydro filters, 1x cabin filter, grease, 26qts oil, hydro, Went to Boyer for fuel and oil filter that we did not have in stock. Part Numbers: A 936 090 06 51 - Fuel filter A 936 180 00 09 - Oil filter Boyer came to prime the fuel system.
	ER36	3ALACYD20LDLW9687	YBY7704	7-2-2025	0.00	147.00	hose made 3"
	ER36	3ALACYD20LDLW9687	YBY7704	7-15-2025	135.72	135.72	REPLACE FUSE BOX REWIRE
	ER36	3ALACYD20LDLW9687	YBY7704	7-24-2025	0.00	132.00	ARM TROLLY HOSE RIPPED OFF MADE NEW HOSE CLEANED UP HYDRO LEAK
	ER36	3ALACYD20LDLW9687	YBY7704	5-21-2025	130.76	130.76	ADDED HYDRO
	ER36	3ALACYD20LDLW9687	YBY7704	7-15-2025	0.00	126.00	REPLACE FUSE BOX REWIRE
	ER36	3ALACYD20LDLW9687	YBY7704	1-13-2025	0.00	120.00	assemble valve
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	0.00	120.00	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	10-30-2024	0.00	120.00	inspect truck grease
	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	0.00	120.00	replaced trolley asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	2-6-2025	0.00	120.00	Road call for engine failure. Got towed. p2729 code
	ER36	3ALACYD20LDLW9687	YBY7704	2-6-2025	0.00	120.00	Road call for engine failure. Got towed. p2729 code
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2022	118.50	118.50	replaced all 4 rollers on gripper. also topped off hyd tank.
	ER36	3ALACYD20LDLW9687	YBY7704	2-24-2022	118.50	118.50	replaced trolley transducer
	ER36	3ALACYD20LDLW9687	YBY7704	9-9-2022	117.36	117.36	replaced blower motor and harness. fan still not staying on. after digging found a bad connector in dash. repaired and it is working properly now.
	ER36	3ALACYD20LDLW9687	YBY7704	5-8-2024	116.10	116.10	add hydro
	ER36	3ALACYD20LDLW9687	YBY7704	5-21-2025	113.28	113.28	ADDED HYDRO
	ER36	3ALACYD20LDLW9687	YBY7704	6-27-2024	111.76	111.76	WELD BROKEN HOSE SUPPORTS TIE UP HOSES.
	ER36	3ALACYD20LDLW9687	YBY7704	1-13-2025	105.17	105.17	REPLACE REACH SENSOR HARNESS PINCHED IN BODY REPAIR PSCI CODE PULL PAN DOWN REPLACE PSC SOENOID HARNESS NEW FILTER
Lot#121	ER37	3ALACYD22LDLW9688	YBY7706	2-19-2024	11,073.54	11,073.54	replaced grabber assembly
	ER37	3ALACYD22LDLW9688	YBY7706	12-31-2021	2,243.90	2,243.90	unit came in with hydro leak coming from the pack 3 hydro hoses had hydro leaks from fittings . i replaced the hoses ran packer blade i seen no hydro leaks i then botton up the packer entry and sent unit back out
	ER37	3ALACYD22LDLW9688	YBY7706	2-28-2024	1,646.00	1,646.00	hose holder bent fixed replaced bolts for are base sreightend fingers and moved hoses that were rubbing adjusted arm
	ER37	3ALACYD22LDLW9688	YBY7706	1-21-2025	1,562.70	1,562.70	INSPECTED TROLLY SESNOR AND SECURED BOLTS INSTALLED NEW TROLLY SESNOR AND CALAIBRATED
	ER37	3ALACYD22LDLW9688	YBY7706	11-11-2024	1,562.70	1,562.70	recalabrated sensor came back not zeroing out replace encoder programed ok
	ER37	3ALACYD22LDLW9688	YBY7706	1-23-2025	1,562.70	1,562.70	REPLACE TROLLY SENSOR CALIBRATE
	ER37	3ALACYD22LDLW9688	YBY7706	3-6-2025	1,562.70	1,562.70	REPLACED TROLLY SENSOR
	ER37	3ALACYD22LDLW9688	YBY7706	5-7-2025	1,562.70	1,562.70	replaced trooly sensor
	ER37	3ALACYD22LDLW9688	YBY7706	4-26-2024	1,562.70	1,562.70	tilt pin broken and replaced trolley encoder
	ER37	3ALACYD22LDLW9688	YBY7706	2-24-2022	865.12	865.12	replaced amber light. replaced wire harness. brandnew one was faulty. Replaced grabber cylinder. I cant find the part number for it. Also replaced the def cap. part number on box is 111. Replaced hydraulic hose. Also replaced another hose that pertek made. I dont know the part number.
	ER37	3ALACYD22LDLW9688	YBY7706	3-21-2024	658.40	658.40	replaced leaking valvebody cover cleaned out hooper and filled recal
	ER37	3ALACYD22LDLW9688	YBY7706	6-10-2026	0.00	589.57	REPLACED PROX SWITCH TAIL GATE HYDRAULICS NOW WORK STEAMED OFF TAILGATE TO TRACE WIRING
	ER37	3ALACYD22LDLW9688	YBY7706	3-19-2026	0.00	486.00	GREASED CHASIS AND BODY
	ER37	3ALACYD22LDLW9688	YBY7706	2-22-2022	476.28	476.28	replaced trolley guide roller assembly.
	ER37	3ALACYD22LDLW9688	YBY7706	8-30-2022	345.80	345.80	Filled hydro tank .. replaced packer hydro hose and alarm hydro hose.. couldn't find part mobbers for two fittings 12z-L72 and 12z-s72.. had too goo too peppertree for another hose,.. we didn't have correct fettling.. def fluid is leaking..
	ER37	3ALACYD22LDLW9688	YBY7706	1-5-2022	340.50	340.50	truck came in with fripper issues. after looking i found 2 missing rollers and i that was about to fall off. I installed 3 new and one used. i also found a bad wire one the tilt sensor wire.
	ER37	3ALACYD22LDLW9688	YBY7706	6-5-2024	329.21	329.21	Replaced bakc up alarm. Used 2 heatshrink ss parts
	ER37	3ALACYD22LDLW9688	YBY7706	2-19-2024	0.00	320.00	replaced grabber assembly
	ER37	3ALACYD22LDLW9688	YBY7706	2-19-2024	0.00	320.00	replaced grabber assembly
	ER37	3ALACYD22LDLW9688	YBY7706	4-14-2026	0.00	304.95	FINISHED INSTALL OF WIREHERNESS HARNESS REPLACED INOP LIGHTS COMPLETED DOT CLEANED SHOP
	ER37	3ALACYD22LDLW9688	YBY7706	2-5-2025	297.65	297.65	Replaced cracked end cap.
	ER37	3ALACYD22LDLW9688	YBY7706	3-4-2026	0.00	288.00	clenaing the cabs in 32 33 37
	ER37	3ALACYD22LDLW9688	YBY7706	4-13-2026	277.73	277.73	REPLACED WIRE HARNESS
	ER37	3ALACYD22LDLW9688	YBY7706	1-15-2025	276.90	276.90	REPLACED LEAKING HYDRO HOSES ON ARM

	ER37	3ALACYD22LDLW9688	YBY7706	8-12-2022	247.00	247.00	Topped off hyd tank
	ER37	3ALACYD22LDLW9688	YBY7706	4-5-2022	238.14	238.14	replaced 2 load runners
	ER37	3ALACYD22LDLW9688	YBY7706	4-5-2022	237.00	237.00	replaed two hydraulic hoses.
	ER37	3ALACYD22LDLW9688	YBY7706	3-2-2022	237.00	237.00	TOPPED OFF HYD TANK
	ER37	3ALACYD22LDLW9688	YBY7706	12-31-2021	227.00	227.00	unit came in with trolley issues i found the top load runner was broken . i replaced it with a new one then ran arm trolley / grabber worked great i sent unit out to route
	ER37	3ALACYD22LDLW9688	YBY7706	4-23-2024	198.53	198.53	Replace lower single finger
	ER37	3ALACYD22LDLW9688	YBY7706	10-4-2022	197.60	197.60	filled hydro. tightened bolts on fingers. hydro leak is coming from filter housing on the reservoir tank and the L90 valve. do not have parts to replace at this time.
	ER37	3ALACYD22LDLW9688	YBY7706	1-25-2022	190.40	190.40	Unit came in with broken hydro lines. replaced fittings, hoses, and filled hydro tank. No leaks detected. sent it back out to route
	ER37	3ALACYD22LDLW9688	YBY7706	2-9-2024	0.00	180.00	arm not moving got arm to move by so driver could finih route found wire rubbed through fixed adjusted arm functions recalibrated
	ER37	3ALACYD22LDLW9688	YBY7706	1-18-2022	166.60	166.60	unit came in with low hydro i filled the tank to full and sent unit out to route
	ER37	3ALACYD22LDLW9688	YBY7706	2-13-2024	164.60	164.60	adjusted arm found rubbed through wiring and upgraded fuse
	ER37	3ALACYD22LDLW9688	YBY7706	3-26-2024	164.60	164.60	arm not coming in all the way adjusted pressres and recal
	ER37	3ALACYD22LDLW9688	YBY7706	2-9-2024	164.60	164.60	arm not moving got arm to move by so driver could finih route found wire rubbed through fixed adjusted arm functions recalibrated
	ER37	3ALACYD22LDLW9688	YBY7706	3-27-2024	164.60	164.60	engine noise looked in to loose componets under valve cover need to go to boyer
	ER37	3ALACYD22LDLW9688	YBY7706	4-19-2024	164.60	164.60	Hydro hoses rubbing in rear and on cooler, shield.
	ER37	3ALACYD22LDLW9688	YBY7706	4-1-2024	164.60	164.60	pick up er37 and deliver er14
	ER37	3ALACYD22LDLW9688	YBY7706	3-27-2024	164.60	164.60	removed all ice cleaned out conections fixed wires to door sensor
	ER37	3ALACYD22LDLW9688	YBY7706	2-19-2024	164.60	164.60	replaced grabber assembly
	ER37	3ALACYD22LDLW9688	YBY7706	3-13-2024	164.60	164.60	replaced grabber cylinder hose
	ER37	3ALACYD22LDLW9688	YBY7706	4-26-2024	164.60	164.60	reset arm
	ER37	3ALACYD22LDLW9688	YBY7706	4-26-2024	164.60	164.60	tilt pin broken and replaced trolley encoder
	ER37	3ALACYD22LDLW9688	YBY7706	4-19-2024	164.60	164.60	Zerks missing on arm, moved nipples around to grease. Could not get out broken zerk in tilt, didnt have time for lower finger rod end broken zerk.
	ER37	3ALACYD22LDLW9688	YBY7706	4-1-2024	164.60	164.60	zip tie wires up
	ER37	3ALACYD22LDLW9688	YBY7706	2-28-2024	0.00	160.00	hose holder bent fixed replaced bolts for are base sreightend fingers and moved hoses that were rubbing adjusted arm
	ER37	3ALACYD22LDLW9688	YBY7706	11-13-2024	0.00	160.00	REPLACE WIRE HARNESS TO mc43
	ER37	3ALACYD22LDLW9688	YBY7706	1-4-2024	0.00	160.00	tested need modules
	ER37	3ALACYD22LDLW9688	YBY7706	4-26-2024	0.00	160.00	tilt pin broken and replaced trolley encoder
	ER37	3ALACYD22LDLW9688	YBY7706	4-19-2024	0.00	160.00	Wet PM with cabin air filter. 8800 hours problems: Water in tanks Rear hydro hoses rubbing Hydro hose on cooler corner rubbing 2 broken zerks on finger rod end and lower tilt Batteries dirty Valve cover leak on back of engine
	ER37	3ALACYD22LDLW9688	YBY7706	2-24-2022	142.20	142.20	replaced amber light. replaced wire harness. brandnew one was faulty. Replaced grabber cylinder. I cant find the part number for it. Also replaced the def cap. part number on box is 111. Replaced hydraulic hose. Also replaced another hose that pertek made. I dont know the part number.
	ER37	3ALACYD22LDLW9688	YBY7706	11-13-2024	136.50	136.50	REPLACE WIRE HARNESS TO mc43
	ER37	3ALACYD22LDLW9688	YBY7706	12-31-2021	132.21	132.21	unit came in with hydro leak coming from the pack 3 hydro hoes had hydro leaks from fittings . i replaced the hoses ran packer blade i seen no hydro leaks i then botton up the packer entry and sent unit back out
	ER37	3ALACYD22LDLW9688	YBY7706	11-11-2024	0.00	132.00	recalabrated sensor came back not zeroing out replace encoder programed ok
	ER37	3ALACYD22LDLW9688	YBY7706	1-25-2024	129.00	129.00	filled hydro tank
	ER37	3ALACYD22LDLW9688	YBY7706	3-21-2024	129.00	129.00	replaced leaking valvebody cover cleaned out hooper and filled recal
	ER37	3ALACYD22LDLW9688	YBY7706	3-4-2025	126.99	126.99	Replaced CnC tubes
	ER37	3ALACYD22LDLW9688	YBY7706	6-20-2025	0.00	126.00	ADJUST ARM CHAIN AND SENSOR
	ER37	3ALACYD22LDLW9688	YBY7706	4-9-2026	0.00	121.98	REMOVED WIRING HARNESS NEW HARNESS ORDERED
	ER37	3ALACYD22LDLW9688	YBY7706	2-13-2024	0.00	120.00	adjusted arm found rubbed through wiring and upgraded fuse
	ER37	3ALACYD22LDLW9688	YBY7706	3-27-2024	0.00	120.00	engine noise looked in to loose componets under valve cover need to go to boyer
	ER37	3ALACYD22LDLW9688	YBY7706	11-11-2024	0.00	112.00	recalabrated sensor came back not zeroing out replace encoder programed ok
	ER37	3ALACYD22LDLW9688	YBY7706	1-16-2025	0.00	100.00	REPLACED 6 HYDRO. LINES THAT WERE LEAKING
	ER37	3ALACYD22LDLW9688	YBY7706	11-12-2024	0.00	100.00	REWIRE LIGHT AND CLEAN OUT CONNECTORS OIL COVERED