

	ER32	1FVACYFE2LHLC2951	YBY3874	4-26-2024	0.00	160.00	Replaced hydraulic hoses on arm 4/12 GS - replaced hydraulic hoses on upper arm. 12 fittings, 6 hoses, & 1 o-ring. 4/17 GS - Replaced 1 broken snapped finger, bent other finger back in place. Replaced 2 backing bars. (1 missing, one snapped off) hopper cover not open
	ER32	1FVACYFE2LHLC2951	YBY3874	3-12-2024	0.00	160.00	resealed valve body cleaned drained side tank part parker seal kit 393000k871
	ER32	1FVACYFE2LHLC2951	YBY3874	4-16-2024	0.00	160.00	seal trans crack inside casing filled
	ER32	1FVACYFE2LHLC2951	YBY3874	4-16-2025	156.50	156.50	tubes cpr water pump fuel transfer
	ER32	1FVACYFE2LHLC2951	YBY3874	3-12-2024	154.80	154.80	resealed valve body cleaned drained side tank part parker seal kit 393000k871
	ER32	1FVACYFE2LHLC2951	YBY3874	5-5-2025	154.41	154.41	BEARING OLLIE FLANGE BEARING GRIP LINK
	ER32	1FVACYFE2LHLC2951	YBY3874	12-16-2021	149.50	149.50	unit came in low on hydro filled hydro tank . unit ran great sent out to route
	ER32	1FVACYFE2LHLC2951	YBY3874	4-23-2025	0.00	144.00	hose replacement
	ER32	1FVACYFE2LHLC2951	YBY3874	11-1-2024	0.00	140.00	PTO INOP LOOK INTO PTO SHORT ALWAYS HAS POWER
	ER32	1FVACYFE2LHLC2951	YBY3874	12-7-2021	131.52	131.52	unite cam in with hydro lines no longer held or attached to head of trolley I I took off all hydro hose on bracket . I cleaned and welded on a new piece . I reattached hydro hose's ran arm worked great sent to route
	ER32	1FVACYFE2LHLC2951	YBY3874	4-16-2025	130.71	130.71	tubes cpr water pump fuel transfer
	ER32	1FVACYFE2LHLC2951	YBY3874	4-30-2025	0.00	126.00	no start found loose injector hold down
	ER32	1FVACYFE2LHLC2951	YBY3874	4-2-2025	0.00	126.00	test fuel system
	ER32	1FVACYFE2LHLC2951	YBY3874	5-20-2025	0.00	126.00	WIRE HARNESS FOR PAC TECH
	ER32	1FVACYFE2LHLC2951	YBY3874	1-20-2025	124.84	124.84	arm banging and jerky replaced reach harness upon running radiator decied to burst R&R raditaor
	ER32	1FVACYFE2LHLC2951	YBY3874	3-7-2024	0.00	120.00	arm inop went and found broken wires stowed it came to the shop replaced arm harness
	ER32	1FVACYFE2LHLC2951	YBY3874	4-2-2024	0.00	120.00	cckek engine lights fixed my need def heater replaced not at this time regen
	ER32	1FVACYFE2LHLC2951	YBY3874	3-25-2025	0.00	120.00	DOT FOUND BRAKES AND ABS IGHIT AND LEAK
	ER32	1FVACYFE2LHLC2951	YBY3874	3-14-2024	0.00	120.00	Filuid cleanup 211 Exeter Pl TRUCK SNAPPED CHAIN ON ROUTE
	ER32	1FVACYFE2LHLC2951	YBY3874	3-25-2025	0.00	120.00	STARTED PM CHANGED AND GREASED AND DID PAPERWORK
	ER32	1FVACYFE2LHLC2951	YBY3874	4-28-2025	0.00	115.20	CONTINUE WORK ON ENGINE
	ER32	1FVACYFE2LHLC2951	YBY3874	3-19-2025	113.28	113.28	REINSTALL HARNESS
	ER32	1FVACYFE2LHLC2951	YBY3874	4-23-2024	0.00	112.00	replaced fingers 4/23 replaced tilt sensor cable, test drive, checked codes, replaced arm wire harness.
	ER32	1FVACYFE2LHLC2951	YBY3874	3-19-2026	0.00	112.00	WORKED ON WIRE HARNESS W/JOSH
	ER32	1FVACYFE2LHLC2951	YBY3874	1-20-2025	111.76	111.76	arm banging and jerky replaced reach harness upon running radiator decied to burst R&R raditaor
	ER32	1FVACYFE2LHLC2951	YBY3874	1-22-2025	111.76	111.76	ARM LOSING CALAIBRATION RANGE LOW ERROR REPLACED HARNESS ARM REACH ON RETRACT GOES TO ZERO 2 FEET AWAY BODY THEN LOSS UPTIGHT NEED REACH CYLINDER PART ORDERED
	ER32	1FVACYFE2LHLC2951	YBY3874	5-2-2025	0.00	108.00	FIXED A FUEL LEAK
	ER32	1FVACYFE2LHLC2951	YBY3874	3-7-2024	103.20	103.20	arm inop went and found broken wires stowed it came to the shop replaced arm harness
	ER32	1FVACYFE2LHLC2951	YBY3874	4-22-2025	0.00	100.80	TUBE FUEL LINE SUPPLY
	ER32	1FVACYFE2LHLC2951	YBY3874	7-1-2024	0.00	100.00	DOOR INOP, R&R DOOR LATCH, PULLED FROM ER33 TO GET TRUCK ON THE ROAD.
	ER32	1FVACYFE2LHLC2951	YBY3874	3-31-2025	0.00	100.00	NEEDS PARTS NOT BUILDING PRESURE
	ER32	1FVACYFE2LHLC2951	YBY3874	1-25-2024	0.00	100.00	pack assist pin came out replaced it and put on new tail gate hoses need to be added pirttek
	ER32	1FVACYFE2LHLC2951	YBY3874	3-26-2025	0.00	100.00	PULL FUEL LINES
	ER32	1FVACYFE2LHLC2951	YBY3874	4-26-2024	0.00	100.00	Replaced hydraulic hoses on arm 4/12 GS - replaced hydraulic hoses on upper arm. 12 fittings, 6 hoses, & 1 o-ring. 4/17 GS - Replaced 1 broken snapped finger, bent other finger back in place. Replaced 2 backing bars. (1 missing, one snapped off) hopper cover not open
	ER32	1FVACYFE2LHLC2951	YBY3874	1-23-2025	0.00	100.00	REPLACED REACH CYLINDER AND WIRE HARNESS
	ER32	1FVACYFE2LHLC2951	YBY3874	11-5-2024	0.00	100.00	REWIRED
Lot#124	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	2,098.84	2,098.84	replaced hood mirror replaced rear drums and shoes fixed air leak fixed lights
	ER33	1FVACYFE6LHLC2953	YBY3877	5-29-2025	1,872.64	1,872.64	R&R GRABBER CYLINDER
	ER33	1FVACYFE6LHLC2953	YBY3877	4-5-2024	1,562.70	1,562.70	4/3 GS - grabber cylinder hydro hose had a bad/bent fitting. Replaced with new one. stopped leak. Didn't get engine hours. 4/4 GS - Replaced trolley sensor. Calibrated. Replaced three mounting screws. 4/5 GS - belt plate on double finger snapped. Replaced 1 part.
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	1,562.70	1,562.70	Replaced missing pin cover and collar. Scraped broken collar pieces. Bearing was fine. Tightened loose hydro hose on grabber cylinder. 4/1 Trolley sensor + harness replace, replace 2x hoses for tilt cylinder on trolley, weld bracket on lower hose bracket, replace 2x missing bolts on finger pin plate (counted as 1x shop supply), 20 qts hydro fluid 7/3 tightened and replaced roller on trolley, tightened chain.
	ER33	1FVACYFE6LHLC2953	YBY3877	4-20-2022	1,389.64	1,389.64	replaced all drive tires on truck.

	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	934.70	934.70	replaced hood mirror replaced rear drums and shoes fixed air leak fixed lights
	ER33	1FVACYFE6LHLC2953	YBY3877	2-28-2022	670.04	670.04	replaced left rear wheel due to it was flat.
	ER33	1FVACYFE6LHLC2953	YBY3877	4-5-2024	658.40	658.40	4/3 GS - grabber cylinder hydro hose had a bad/bent fitting. Replaced with new one. stopped leak. Didn't get engine hours. 4/4 GS - Replaced trolley sensor. Calibrated. Replaced three mounting screws. 4/5 GS - belt plate on double finger snapped. Replaced 1 part.
	ER33	1FVACYFE6LHLC2953	YBY3877	4-26-2024	658.40	658.40	clean and weld cane
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	658.40	658.40	replaced hood mirror replaced rear drums and shoes fixed air leak fixed lights
	ER33	1FVACYFE6LHLC2953	YBY3877	10-21-2024	504.45	504.45	DROPPING CARTS REBUILT ARM
	ER33	1FVACYFE6LHLC2953	YBY3877	2-22-2024	493.80	493.80	Welded broken tipper rail back on.
	ER33	1FVACYFE6LHLC2953	YBY3877	5-22-2025	469.56	469.56	WIRE IN NEW HARNESS AND TALK TO PAC TECH
	ER33	1FVACYFE6LHLC2953	YBY3877	12-31-2021	454.00	454.00	unit came in with trolley issues after my initial inspection i seen both bottom load runners are broke. i replaced both load runners with new ones and tightned chain. i then ran arm to make sure it ran great . after ranning the arm i seen no other issues . unit was sent back out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	4-16-2024	453.50	453.50	Wet PM Issues left: loose fuel tank loose def tank all 4 tailgate hoses loose rear right hydro hardlines rubbing left hood mirror loose rubbing rear main hose rubbing right TG hoses main valve body leak D1LO sliced Right hydro hose rubbing behind cab
	ER33	1FVACYFE6LHLC2953	YBY3877	1-11-2022	380.60	380.60	replaced leaking hydro hose . i added coolant to the tank . and replaced bad rear outer drive tire i looked everything over and sent unit out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	2-6-2024	336.30	336.30	Replaced bearings of finger. adjusted/tightened other finger. Tightened trolley to arm rollers. replaced 1. regreased. calibrated.
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	329.20	329.20	Replaced missing pin cover and collar. Scraped broken collar pieces. Bearing was fine. Tightened loose hydro hose on grabber cylinder. 4/1 Trolley sensor + harness replace, replace 2x hoses for tilt cylinder on trolley, weld bracket on lower hose bracket, replace 2x missing bolts on finger pin plate (counted as 1x shop supply), 20 qts hydro fluid 7/3 tightened and replaced roller on trolley. tightened chain.
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	0.00	320.00	Welded new floor plate inside body. Cleaned out inside of debris and fire hazards. Cut plate to size and welded it in.
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	0.00	320.00	Welded new floor plate inside body. Cleaned out inside of debris and fire hazards. Cut plate to size and welded it in.
	ER33	1FVACYFE6LHLC2953	YBY3877	10-21-2024	308.82	308.82	DROPPING CARTS REBUILT ARM
	ER33	1FVACYFE6LHLC2953	YBY3877	12-9-2021	299.00	299.00	unit came in with broken hydro line . i replaced the hydro filled up tank .unit was sent back out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	2-24-2022	286.11	286.11	replaced hyraulic hose. used 6ft of hose and 2 fittings. filled hydro tank witg 53 qts Replaced left finger assembly.
	ER33	1FVACYFE6LHLC2953	YBY3877	1-18-2022	286.11	286.11	unit come in having issues with the grabbet and bent fingers i replaced the single and double finger . after a quick test of the grabber i seen the smart cyclinder was bent so i replaced it with a new one and some hardwaer i topped off the hydro tank and sent the unit out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	0.00	280.00	Replaced missing pin cover and collar. Scraped broken collar pieces. Bearing was fine. Tightened loose hydro hose on grabber cylinder. 4/1 Trolley sensor + harness replace, replace 2x hoses for tilt cylinder on trolley, weld bracket on lower hose bracket, replace 2x missing bolts on finger pin plate (counted as 1x shop supply), 20 qts hydro fluid 7/3 tightened and replaced roller on trolley. tightened chain.
	ER33	1FVACYFE6LHLC2953	YBY3877	4-17-2024	0.00	280.00	startedtightening fuel tank strapbut bolt broke, strap is on the way. still needs hoses tied up, speed sensors, tire tailgate hoses, work lightsout, ac doesn't work, left shock bolt loose, fire ext unsecured Start replacingtrans cooler hoses
	ER33	1FVACYFE6LHLC2953	YBY3877	1-18-2022	247.98	247.98	unit come in having issues with the grabbet and bent fingers i replaced the single and double finger . after a quick test of the grabber i seen the smart cyclinder was bent so i replaced it with a new one and some hardwaer i topped off the hydro tank and sent the unit out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	5-28-2025	246.30	246.30	R&R SOLOINOID

	ER33	1FVACYFE6LHLC2953	YBY3877	5-9-2024	0.00	240.00	JACK UP TRUCK TRUCK, REMOVE TIRES, BACK BRAKES OFF REMOVE DRUMS, TAKE WIRE WHEEL TO SHOES, THEN GRIND AND BEVEL SHOE EDGES. WHEN BACKING OFF LH SLACK FOUND ADJUSTER VERY WEAK, R&R SLACK. CAGE BRAKE PULL SLACK REINSTALL AND TIME ADJUSTER. GREASED BOTH SIDES SLACKS AND SCAM TUBES. REINSTALL BRAKE COMPONENTS, WHEELS AND ADJUSTED BRAKES. TORQUES WHEELS TO 450 FT/LBS.
	ER33	1FVACYFE6LHLC2953	YBY3877	2-6-2024	0.00	240.00	Replaced bearings of finger. adjusted/tightened other finger. Tightened trolley to arm rollers. replaced 1. regreased. calibrated.
	ER33	1FVACYFE6LHLC2953	YBY3877	2-6-2024	238.14	238.14	Replaced bearings of finger. adjusted/tightened other finger. Tightened trolley to arm rollers. replaced 1. regreased. calibrated.
	ER33	1FVACYFE6LHLC2953	YBY3877	2-24-2022	237.00	237.00	replaced hydraulic hose. used 6ft of hose and 2 fittings. filled hydro tank with 53 qts Replaced left finger assembly.
	ER33	1FVACYFE6LHLC2953	YBY3877	12-22-2021	225.40	225.40	unit came in with a packer hose leaking hydro . i replaced the hose with a 12zs72 and 12zlong 90 female end fitting topped off hydro tank ran packer no leaks . unit sent out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	3-17-2025	215.04	215.04	REPLACED BATTERIES
	ER33	1FVACYFE6LHLC2953	YBY3877	1-11-2022	214.20	214.20	replaced leaking hydro hose . i added coolant to the tank . and replaced bad rear outer drive tire i looked everything over and sent unit out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	1-18-2022	214.20	214.20	unit come in having issues with the grabber and bent fingers i replaced the single and double finger . after a quick test of the grabber i seen the smart cylinder was bent so i replaced it with a new one and some hardware i topped off the hydro tank and sent the unit out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	2-12-2025	212.49	212.49	REPLACE HEAD LIGHT AASY.
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	205.26	205.26	5/30 - A/C recharge. Replace cabin air filter. Replace two A/C lines 6/5 -
	ER33	1FVACYFE6LHLC2953	YBY3877	4-16-2024	0.00	204.00	Wet PM Issues left: loose fuel tank loose def tank all 4 tailgate hoses loose rear right hydro hardlines rubbing left hood mirror loose rubbing rear main hose rubbing right TG hoses main valve body leak D1LO sliced Right hydro hose rubbing behind cab
	ER33	1FVACYFE6LHLC2953	YBY3877	4-17-2024	0.00	200.00	Finished tranny cooler line install. filled trans w 15 qt, ran and leak tested. supply to cooler leaks. shielded hoses. replaced leakin o ring. replaced tank strap, tighten steps.
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	195.14	195.14	replaced hood mirror replaced rear drums and shoes fixed air leak fixed lights
	ER33	1FVACYFE6LHLC2953	YBY3877	6-8-2026	0.00	189.00	TEST OUT PAC-TECH'S FOR SALE
	ER33	1FVACYFE6LHLC2953	YBY3877	5-28-2024	168.15	168.15	Replace single finger bushings and bearing, replace broken pin bolts and tighten main bolt. Tighten double finger main bolt replaced belt
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	168.15	168.15	Replaced missing pin cover and collar. Scraped broken collar pieces. Bearing was fine. Tightened loose hydro hose on grabber cylinder. 4/1 Trolley sensor + harness replace, replace 2x hoses for tilt cylinder on trolley, weld bracket on lower hose bracket, replace 2x missing bolts on finger pin plate (counted as 1x shop supply), 20 qts hydro fluid 7/3 tightened and replaced roller on trolley. tightened chain.
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	164.60	164.60	5/30 - A/C recharge. Replace cabin air filter. Replace two A/C lines 6/5 -
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	164.60	164.60	dot
	ER33	1FVACYFE6LHLC2953	YBY3877	3-28-2024	164.60	164.60	filled coolant
	ER33	1FVACYFE6LHLC2953	YBY3877	4-17-2024	164.60	164.60	Finished tranny cooler line install. filled trans w 15 qt, ran and leak tested. supply to cooler leaks. shielded hoses. replaced leakin o ring. replaced tank strap, tighten steps.
	ER33	1FVACYFE6LHLC2953	YBY3877	5-28-2024	164.60	164.60	Replace single finger bushings and bearing, replace broken pin bolts and tighten main bolt. Tighten double finger main bolt replaced belt
	ER33	1FVACYFE6LHLC2953	YBY3877	2-6-2024	164.60	164.60	Replaced bearings of finger. adjusted/tightened other finger. Tightened trolley to arm rollers. replaced 1. regreased. calibrated.
	ER33	1FVACYFE6LHLC2953	YBY3877	2-6-2024	164.60	164.60	Replaced hose on trolley Used 4.14 qts of hydro
	ER33	1FVACYFE6LHLC2953	YBY3877	1-25-2024	164.60	164.60	replaced leaking hose and adjust chain
	ER33	1FVACYFE6LHLC2953	YBY3877	2-6-2024	164.60	164.60	Weld repair on hose hanging bracket on trolley. Added support bracket.
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	164.60	164.60	Welded new floor plate inside body. Cleaned out inside of debris and fire hazards. Cut plate to size and welded it in.
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	0.00	160.00	replaced hood mirror replaced rear drums and shoes fixed air leak fixed lights

	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	0.00	160.00	replaced hood mirror replaced rear drums and shoes fixed air leak fixed lights
	ER33	1FVACYFE6LHLC2953	YBY3877	3-4-2026	0.00	154.51	PM THE TRUCK TO SELL
	ER33	1FVACYFE6LHLC2953	YBY3877	5-28-2024	154.41	154.41	Replace single finger bushings and bearing, replace broken pin bolts and tighten main bolt. Tighten double finger main bolt replaced belt
	ER33	1FVACYFE6LHLC2953	YBY3877	5-9-2024	154.41	154.41	REPLACE UPPER AND LOWER BEARINGS, PLATE AND BOLT ON REAR GRABBER PIVOT.
	ER33	1FVACYFE6LHLC2953	YBY3877	5-9-2024	152.31	152.31	REPLACE UPPER AND LOWER BEARINGS, PLATE AND BOLT ON REAR GRABBER PIVOT.
	ER33	1FVACYFE6LHLC2953	YBY3877	1-11-2024	149.47	149.47	Replaced finger replaced 3x clearance lights
	ER33	1FVACYFE6LHLC2953	YBY3877	1-18-2022	149.47	149.47	unit come in having issues with the grabber and bent fingers i replaced the single and double finger . after a quick test of the grabber i seen the smart cyclinder was bent so i replaced it with a new one and some hardware i topped off the hydro tank and sent the unit out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	0.00	140.00	5/30 - A/C recharge. Replace cabin air filter. Replace two A/C lines 6/5 -
	ER33	1FVACYFE6LHLC2953	YBY3877	3-14-2024	0.00	140.00	filled coolant low filled coolant changed service call
	ER33	1FVACYFE6LHLC2953	YBY3877	4-16-2024	0.00	140.00	Wet PM Issues left: loose fuel tank loose def tank all 4 tailgate hoses loose rear right hydro hardlines rubbing left hood mirror loose rubbing rear main hose rubbing right TG hoses main valve body leak D1LO sliced Right hydro hose rubbing behind cab
	ER33	1FVACYFE6LHLC2953	YBY3877	12-16-2021	135.24	135.24	unit came in with broken hydro hoses i replaced hoses and filled hydro tank . i ran arm seen no leaks sent unit out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	10-21-2024	130.76	130.76	DROPPING CARTS REBUILT ARM
	ER33	1FVACYFE6LHLC2953	YBY3877	4-16-2024	130.64	130.64	Wet PM Issues left: loose fuel tank loose def tank all 4 tailgate hoses loose rear right hydro hardlines rubbing left hood mirror loose rubbing rear main hose rubbing right TG hoses main valve body leak D1LO sliced Right hydro hose rubbing behind cab
	ER33	1FVACYFE6LHLC2953	YBY3877	5-22-2025	0.00	126.00	WIRE IN NEW HARNESS AND TALK TO PAC TECH
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	120.73	120.73	5/30 - A/C recharge. Replace cabin air filter. Replace two A/C lines 6/5 -
	ER33	1FVACYFE6LHLC2953	YBY3877	4-5-2024	0.00	120.00	4/3 GS - grabber cylinder hydro hose had a bad/bent fitting. Replaced with new one. stopped leak. Didn't get engine hours. 4/4 GS - Replaced trolley sensor. Calibrated. Replaced three mounting screws. 4/5 GS - belt plate on double finger snapped. Replaced 1 part.
	ER33	1FVACYFE6LHLC2953	YBY3877	5-28-2024	0.00	120.00	Replace single finger bushings and bearing, replace broken pin bolts and tighten main bolt. Tighten double finger main bolt replaced belt
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	0.00	120.00	Replaced missing pin cover and collar. Scraped broken collar pieces. Bearing was fine. Tightened loose hydro hose on grabber cylinder. 4/1 Trolley sensor + harness replace, replace 2x hoses for tilt cylinder on trolley, weld bracket on lower hose bracket, replace 2x missing bolts on finger pin plate (counted as 1x shop supply), 20 qts hydro fluid 7/3 tightened and replaced roller on trolley. tightened chain.
	ER33	1FVACYFE6LHLC2953	YBY3877	2-10-2025	0.00	120.00	Replaced PTD coil
	ER33	1FVACYFE6LHLC2953	YBY3877	1-25-2024	0.00	120.00	RH DRIVE COLUMN LOOSE, FOUND WELDS BROKEN ON TILT ASSEMBLY. PULLED WHEEL AND REMOVED COLUMN TO GET PART NUMBERS OFF UNIT. CALLED ISTATE AND TRACKED DOWN CORRECT PARTS ON ORDER. REASSEMBLED COLUMN AND WELDED UP BROKEN LINKAGE MOUNTS. INSTALLED WHEEL AND WIRED IN HORN BUTTON.
	ER33	1FVACYFE6LHLC2953	YBY3877	11-14-2024	0.00	120.00	weld arm hose brackets and fix grabber loose not closing
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	119.07	119.07	Replaced missing pin cover and collar. Scraped broken collar pieces. Bearing was fine. Tightened loose hydro hose on grabber cylinder. 4/1 Trolley sensor + harness replace, replace 2x hoses for tilt cylinder on trolley, weld bracket on lower hose bracket, replace 2x missing bolts on finger pin plate (counted as 1x shop supply), 20 qts hydro fluid 7/3 tightened and replaced roller on trolley. tightened chain.
	ER33	1FVACYFE6LHLC2953	YBY3877	12-9-2021	115.92	115.92	unit came in with broken hydro line . i replaced the hydro filled up tank .unit was sent back out to route
	ER33	1FVACYFE6LHLC2953	YBY3877	4-29-2025	113.28	113.28	REPLACE REACH SENSOR HARNESS

	ER33	1FVACYFE6LHLC2953	YBY3877	8-9-2024	0.00	112.00	LOOSE CHAIN CALABRATE TROLLY SENSOR WELD BROKEN HOSE BRACKET
	ER33	1FVACYFE6LHLC2953	YBY3877	5-9-2024	111.26	111.26	JACK UP TRUCK TRUCK, REMOVE TIRES, BACK BRAKES OFF REMOVE DRUMS, TAKE WIRE WHEEL TO SHOES, THEN GRIND AND BEVEL SHOE EDGES. WHEN BACKING OFF LH SLACK FOUND ADJUSTER VERY WEAK, R&R SLACK. CAGE BRAKE PULL SLACK REINSTALL AND TIME ADJUSTER. GREASED BOTH SIDES SLACKS AND SCAM TUBES. REINSTALL BRAKE COMPONENTS, WHEELS AND ADJUSTED BRAKES. TORQUES WHEELS TO 450 FT/LBS.
	ER33	1FVACYFE6LHLC2953	YBY3877	7-3-2024	108.66	108.66	5/30 - A/C recharge. Replace cabin air filter. Replace two A/C lines 6/5 -
	ER33	1FVACYFE6LHLC2953	YBY3877	4-26-2024	0.00	100.00	clean and weld cane
	ER33	1FVACYFE6LHLC2953	YBY3877	3-21-2024	0.00	100.00	dot
	ER33	1FVACYFE6LHLC2953	YBY3877	3-25-2025	0.00	100.00	DOT FINISH REPLACED COOLANT LEVEL SENSOR DIAG ENGINE LIGH
Lot#125	ER34	1FVACYFE4LHLC2952	YBY3876	3-19-2024	5,618.90	5,618.90	found pto switch no working all the time orderd fixed broken tilt pin 3/19 Repaired broken collection arm that fell off during route. Replaced main beam. regreased. calibrated. had to cut off and reweld hose arm bracket to proper orientation and placemet. removed broken ladder part from left side. Still need to add locking washer part. Part Number not in dossier Replaced arm harness
	ER34	1FVACYFE4LHLC2952	YBY3876	4-12-2024	5,030.05	5,030.05	4/10 GS - hydro leak from trollet pump control cube. Hydro level not low. REPLACED CRACKED ARM.
	ER34	1FVACYFE4LHLC2952	YBY3876	6-5-2024	2,469.00	2,469.00	Truck came in for slow hydro leak and to discuss A/C issues. Drained the Hydro from valve section area. Topped of the hydro tank. (Patrick M. filled the hydro. is entered in Dossier under separate & closed RO case.) GS - Assisted Pirtek with replacement of steel line. Night hydraulic spill cleanup. Service call to truck on route with arm acting up. adjusted arrangement of upper arm hoses. make hoses and replaced leaking ones 6/3 GS & PM Replace missing fuse for PTO. 1x SS part. 6/3 GS & JS service call on route to address overheating hydro system. JS adjusted pack cycle. Waiting to hear from driver/fleet if overheating persists. May need additional hydro coolers. 6/4 - Slow arm speed complaint. Is set to slower to help with overheating hydro issue.
	ER34	1FVACYFE4LHLC2952	YBY3876	1-2-2025	1,925.20	1,925.20	REMOVED AND REPLACED ACTUATOR BOLTS BROKE OFF AND IN TURBO HAD TO REMOVE IT
	ER34	1FVACYFE4LHLC2952	YBY3876	3-21-2025	1,648.86	1,648.86	FIXED ARM THAT WAS INCONSISTENT REPLACED GRABBER CYLINDER AMD CHECKED ARM TO MAKE SURE IT OPOPERATES
	ER34	1FVACYFE4LHLC2952	YBY3876	4-26-2024	1,354.57	1,354.57	pto kicking out random fix tilt bushing hold down replaced tilt cylinger and clocked hose replaced broken hoses wrapped hoses 4/23 - replaced upper arm hoses. Replaced missing left steer hub plug. Hub fluid looks clear and uncontaminated.
	ER34	1FVACYFE4LHLC2952	YBY3876	4-26-2024	1,152.20	1,152.20	pto kicking out random fix tilt bushing hold down replaced tilt cylinger and clocked hose replaced broken hoses wrapped hoses 4/23 - replaced upper arm hoses. Replaced missing left steer hub plug. Hub fluid looks clear and uncontaminated.
	ER34	1FVACYFE4LHLC2952	YBY3876	3-7-2024	1,152.20	1,152.20	Replaced arm out hydraulic hose
	ER34	1FVACYFE4LHLC2952	YBY3876	3-7-2024	987.60	987.60	replaced leaking hoses to trolly motor replaced tilt harness replaced arm harness filled service call leaking replaced oring at valve
	ER34	1FVACYFE4LHLC2952	YBY3876	3-20-2026	922.87	922.87	REPLACED THE PTO
	ER34	1FVACYFE4LHLC2952	YBY3876	11-25-2021	734.92	734.92	NEED TO REPLACE RADIATOR. finished installing radiator
	ER34	1FVACYFE4LHLC2952	YBY3876	4-14-2025	535.20	535.20	REPLACED CHAIN
	ER34	1FVACYFE4LHLC2952	YBY3876	2-25-2022	476.28	476.28	replaced hydraulic hose. filled tank with 80 qts. replaced trolly rollers
	ER34	1FVACYFE4LHLC2952	YBY3876	1-16-2025	469.56	469.56	ARM HARNESS R&R TOP ARM HOSES
	ER34	1FVACYFE4LHLC2952	YBY3876	3-21-2025	469.56	469.56	FIXED ARM THAT WAS INCONSISTENT REPLACED GRABBER CYLINDER AMD CHECKED ARM TO MAKE SURE IT OPOPERATES
	ER34	1FVACYFE4LHLC2952	YBY3876	12-31-2021	464.68	464.68	driver bent double finger so needed to replace it
	ER34	1FVACYFE4LHLC2952	YBY3876	7-17-2025	0.00	460.80	ADDED HYDRO AND ATF
	ER34	1FVACYFE4LHLC2952	YBY3876	12-17-2024	460.11	460.11	REPLACED AEM HARNESS FOR GRABBER
	ER34	1FVACYFE4LHLC2952	YBY3876	12-1-2024	460.11	460.11	REPLACED GRABBER SENSOR HARNESS DROVE TO TRUCK ON CALL REPLACED CART FROM ARM AND BROUGHT TRUCK BACK IN THE SHOP SECURED SENSOR BACK TOGETHER
	ER34	1FVACYFE4LHLC2952	YBY3876	4-12-2024	453.02	453.02	Replaced arm harness 4/10 GS - hydro leak from trollet pump control cube. Hydro level not low. REPLACED CRACKED ARM.
	ER34	1FVACYFE4LHLC2952	YBY3876	3-7-2024	453.02	453.02	replaced leaking hoses to trolly motor replaced tilt harness replaced arm harness filled service call leaking replaced oring at valve