

INVOICE

 Invoice No.:
 52092

 Date:
 06/13/2022

 Ship Date:

 Page:
 1

 Re: Order No.





Business No.: 865473698RP0001

Item No.	Unit	Quantity	Description	Тах	Unit Price	Amount
			JOB #1 - HARD CRANK ^ TRUCK CRANKED STRON WHEN BRINGING INTO SHOP ^ DISCONNECTED & LOAD TESTED BATTERIES ^ ALL WENT FRONT 12V -> 8.4-8.8V WITH 500A LOAD ^ RECONNECTED & TESTED ALTERNATOR OUT PUT - 140A WITH LOAD ON BATTERIES ^ BATTERY SHUT OFF IS PROPERLY ON GROUND WIRES. WORKS AS IT SHOULD	11		
LB4110	Each	2.5	LABOUR JOB TOTAL \$337.50 JOB #2 - CLEAN RAD ^ UNBOLTED A/C CONDENSOR & PUT ON TOP OF ENGINE WITHOUT DISCONNECTING ^ UNBOLTED AIR TO AIR, PLACED ON HOOD ^ PRESSURE TESTED AIR TO AIR WHILE OFF, HELD 40 PSI ^ RAD WASN'T BADLY PLUGGED. VACUUMED & USED BLOW GUN TO CLEAN OUT ^ REINSTALLED AIR TO AIR & A/C CONDENSOR ^ INSTALLED ONE NEW CLIP FOR A/C LINE	11	135.00	337.50
904R	Each	1.0	PARTS 1/2X5/8 RUBBER CLAMP	11	1.68	1.68
LB4110	Each	2.5	PARTS TOTAL \$1.68 LABOUR JOB TOTAL \$339.18	11	135.00	337.50
JOB #3 - FULL SERVICE Terms: Net 30. Due 07/13/2022. Comment: No returns on electrical components. Returns after 30 days are subject to a 20% restocking fee.				Cont	inue	



INVOICE





Business No.: 865473698RP0001

Item No.	Unit	Quantity	Description	Тах	Unit Price	Amount
2599273C92 IN0201P FLE-LF14000NN E.H.C.100 OIL 15/40 E EHC10 FLE-CC2602 CHMSUMMER FLE-FF2200 E.H.C.100 FLE-WF2127	EACH EACH Each Each Ltr Each Each Each Each Each Each Each Each	1.0 1.0 42.0 42.0 1.0 1.0 1.0 1.0	 ^ COMPLETED SERVICE AS PER SHEET ^ CHANGED OIL & OIL FILTER ^ REPLACED FUEL FILTERS & AIR FILTERS ^ FREED UP & LUBRICATED CLEVIS PINS ^ GREASED & CHECKED LEVELS ^ CHECKED & ADJUSTED TIRE PRESSURES PARTS AIR FILTER KIT CABIN AIR FILTER OIL FILTER - CUMMINS EHC CHARGE OIL ENGINE PETRO CAN ENIVORMENTAL DISPOSAL FEE DCA TEST STRIPS SUMMER WASHER FLUID FUEL FILTER ISX EHC CHARGE WATER FILTER N/DCA CUMMINS 	11 11 11 11 11 11 11 11 11	578.14 26.20 57.80 1.00 4.21 0.10 2.20 4.98 27.25 1.00 56.01	578.14 26.20 57.80 1.00 176.82 4.20 2.20 4.98 27.25 1.00 56.01
E.H.C.50 GREASE	Each Tube	1.0	EHC CHARGE GREASE	11 11 11	0.50 10.84	0.50 10.84
LB4110	Each	3.0	PARTS TOTAL \$946.94 LABOUR JOB TOTAL \$1,351.94	11	135.00	405.00
			JOB #4 - DRIVER SEAT AIR LEAK ^ FOUND SUPPLY LINE UNDER SEAT LEAKING ^ INSTALLED UNION FITTING NOTE: AIR LINES IN ROUGH CONDITION. TO RUN NEW AIR LINES, SEAT HAS TO BE REMOVED			
FAI868-2-1/2A FAI103-A	Each Each		PARTS AB CONNECTOR 5/32 X 1/8 AB COUPLER1/8 FPT	11 11	7.70 1.49	15.40 1.49
Comment: No r	Terms: Net 30. Due 07/13/2022. Comment: No returns on electrical components. Returns after 30 days are subject to a 20% restocking fee.				Cont	inue



INVOICE

Invoice No.:	52092
Date:	06/13/2022
Ship Date:	
Page:	3
Re: Order No.	





Business No.: 865473698RP0001

Item No.	Unit	Quantity	Description	Тах	Unit Price	Amount
LB4110	Each	1.0	PARTS TOTAL \$16.89 LABOUR JOB TOTAL \$151.89	11	135.00	135.00
			JOB #5 - CHECK ENGINE LIGHT / LOW COOLANT LIGHT			
			 ^ HOOKED UP LAPTOP TO CHECK FOR CODES ^ ALL CODES INACTIVE. MOST RECENT IS TWO COOLANT LEVEL CODES ^ CHECKED COOLANT LEVEL, AT MAX ^ PRESSURE TESTED, HELD 15 PSI, NO VISABLE LEAKS 			
LB4110	Each	2.5	LABOUR JOB TOTAL \$337.50	11	135.00	337.50
			JOB #6 - OIL LEAK			
			 ^ OIL LEAK BETWEEN COMPRESSOR & POWER STEERING PUMP ^ PULLED PUMP, CLEANED SURFACES & INSTALLED NEW GASKET 			
GSK4988280	Each	1.0	PARTS GASKET POWER STEERING PUMP	11	5.71	5.71
LB4110	Each	6.5	PARTS TOTAL \$5.71 LABOUR JOB TOTAL \$883.21	11	135.00	877.50
			JOB #7 - A/C NOT WORKING			
			 A/C COMPRESSOR NOT CUTTING IN. CHECKED FOR POWER & GROUND, DO NOT HAVE POWER JUMPED POWER TO COMPRESSOR, SYSTEM OPERATING PROPERLY 			
Comment: No	Terms: Net 30. Due 07/13/2022. Comment: No returns on electrical components. Returns after 30 days are subject to a 20%				Cont	nue
restocking fee.						



INVOICE

Invoice No.:	52092
Date:	06/13/2022
Ship Date:	
Page:	4
Re: Order No.	



Ship to:



Item No.	Unit	Quantity	Description	Тах	Unit Price	Amount
			A TO GET COMPRESSOR TO CUT IN HAD TO UNPLUG HVAC CONTROL, WOULD RUN FOR 5 MINUTES, CUT OUT & NOT RESTART A CHANGED THERMISTORS, NO CHANGE. DISCONNECTED BUNK CONTROLS, NO CHANGE A SENT TO MAXIM FOR FURTHER REPAIRS			
260622C92	EACH	1.0	PARTS THERMISTOR KIT	11	275.47	275.47
LB4110	Each	3.0	PARTS TOTAL \$275.47 LABOUR JOB TOTAL \$680.47	11	135.00	405.00
SS	EACH	1.0	SHOP SUPPLIES	11	141.75	141.75
			Subtotal:			4,223.44
GST: #86547369	98		11 - GST @ 5%, PST @ 6% GST PST			211.19 253.26
PST: #1834167 Shipped By:	Tracking	Number:			Tatal America	4 007 00
Terms: Net 30. Due 07/13/2022.				Total Amount	4,687.89	
Comment: No returns on electrical components. Returns after 30 days are subject to a 20% restocking fee.				Amount Paid	0.00	
	Sold By:				Amount Owing	4,687.89