

	ER35	3ALACYD29LDLW9686	YBY7705	8-28-2024	0.00	152.00	HYDRO LEAK HAD TO COME BACK MAKE HOSES AND RUN BACK OUT INSTALL AND CLEAN UP
	ER35	3ALACYD29LDLW9686	YBY7705	8-28-2024	0.00	152.00	HYDRO LEAK HAD TO COME BACK MAKE HOSES AND RUN BACK OUT INSTALL AND CLEAN UP
	ER35	3ALACYD29LDLW9686	YBY7705	3-9-2022	142.20	142.20	truck has a big leak under it went out to him and did not have the right stuff to repair due to the size of the hose. i called pertek and thay made the repair and i cleaned up the mess.
	ER35	3ALACYD29LDLW9686	YBY7705	12-21-2021	139.14	139.14	bulkhead module was blowing fuses on f7.F20F22 head was also cracked needed to be taken off and repaired. repair 1) took off grabber head from trolley frame /mount . started to take off all parts . replaced grabber pivot bolt and nut for left side of grabber . replaced grip cyl keeper pin , both baerings and bearing seal's
	ER35	3ALACYD29LDLW9686	YBY7705	1-13-2022	139.14	139.14	unit 35 needed a grabber rebuild . replaced single finger knuckle and gripper head wirred up the trolley and gripper and tilt harness . ran arm. no issues with the arm sent unit out to route .
	ER35	3ALACYD29LDLW9686	YBY7705	11-18-2024	122.50	122.50	completed pm oil change
	ER35	3ALACYD29LDLW9686	YBY7705	11-13-2024	0.00	120.00	INSTALL ARM ON BASE
	ER35	3ALACYD29LDLW9686	YBY7705	3-19-2024	0.00	120.00	not building air tanks frozen full of water replaced cartridge filled tank with shop air still not releasing
	ER35	3ALACYD29LDLW9686	YBY7705	11-18-2024	116.47	116.47	completed pm oil change
	ER35	3ALACYD29LDLW9686	YBY7705	5-20-2024	109.99	109.99	REPLACE AIR DRYER ASSEMBLY TRUCK NOT BUILDING AIR.
	ER35	3ALACYD29LDLW9686	YBY7705	6-4-2025	106.39	106.39	GRIPPER FINGERS CLAW
	ER35	3ALACYD29LDLW9686	YBY7705	2-24-2025	0.00	100.00	replaced all hydro lines on arm that were leaking . filled up truck with hydro
Lot#123	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	11,073.54	11,073.54	replaced trolly asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	9-1-2022	10,567.00	10,567.00	L90 VALVE IS LEAKING BAD IN SIDE CABNET. REPLACED VALVE. ALSO REPLACED REACH CYLINDER
	ER36	3ALACYD20LDLW9687	YBY7704	4-11-2024	2,962.80	2,962.80	Replaced leaking hydro hose on arm, added 22qts hydro fluid, cleaned up excess from leak.
	ER36	3ALACYD20LDLW9687	YBY7704	1-18-2022	2,859.89	2,859.89	unit came in with ope issues with the arm the joystick not working(the active trigger was droken) i replaced it with a new one . i tested the arm and joystick everything worked great . i sent the unit back out to route
	ER36	3ALACYD20LDLW9687	YBY7704	9-1-2022	1,690.15	1,690.15	L90 VALVE IS LEAKING BAD IN SIDE CABNET. REPLACED VALVE. ALSO REPLACED REACH CYLINDER
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	1,648.86	1,648.86	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	2-24-2022	1,431.04	1,431.04	replaced trolly transducer
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	1,112.75	1,112.75	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	823.00	823.00	replaced trolly asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	786.85	786.85	replaced trolly asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	7-25-2024	658.40	658.40	Replace supply side hydro side valve o rings, add hydro
	ER36	3ALACYD20LDLW9687	YBY7704	7-22-2025	0.00	546.00	HOSE LEAK
	ER36	3ALACYD20LDLW9687	YBY7704	5-10-2024	493.80	493.80	CLAW INOP, R&R GRABBER HARNESS OK FLUID LEAK HOSE MADE BY PIRTEK replaced seat
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2022	476.28	476.28	replaced all 4 rollers on gripper. also topped off hyd tank.
	ER36	3ALACYD20LDLW9687	YBY7704	3-10-2025	469.56	469.56	TILT NOT WORKING FOUND LOOSE WIRE REPAIRED
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	453.02	453.02	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	7-3-2025	0.00	450.00	BLOWER MOTOR FUSE
	ER36	3ALACYD20LDLW9687	YBY7704	7-27-2022	336.00	336.00	replaced hydraulic hose going to the packer cylinder. filled hydro tank
	ER36	3ALACYD20LDLW9687	YBY7704	1-13-2025	321.66	321.66	REPAIR PSCI CODE PULL PAN DOWN REPLACE PSC SOENOID HARNESS NEW FILTER

	ER36	3ALACYD20LDLW9687	YBY7704	4-26-2024	305.42	305.42	PM service. 2x fuel filters, 3x hydro filters, 1x cabin filter, grease, 26qts oil, hydro, Went to Boyer for fuel and oil filter that we did not have in stock. Part Numbers: A 936 090 06 51 - Fuel filter A 936 180 00 09 - Oil filter Boyer came to prime the fuel system.
	ER36	3ALACYD20LDLW9687	YBY7704	5-21-2025	291.99	291.99	ADDED HYDRO
	ER36	3ALACYD20LDLW9687	YBY7704	1-18-2022	265.83	265.83	unit came in with ope issues with the arm the joystick not working(the active trigger was droken) i replaced it with a new one . i tested the arm and joystick everything worked great . i sent the unit back out to route
	ER36	3ALACYD20LDLW9687	YBY7704	6-11-2026	0.00	252.00	HELP SHOW OPERATION OF THE PAC TECHS
	ER36	3ALACYD20LDLW9687	YBY7704	9-9-2022	247.00	247.00	topped off hyd tank
	ER36	3ALACYD20LDLW9687	YBY7704	1-8-2025	0.00	240.00	pull trans pan clean and prep for part swap
	ER36	3ALACYD20LDLW9687	YBY7704	9-24-2024	0.00	220.00	PTONOT ACTINCTING REPLACED PTO SOSLNOID CHECKED FUSES CONFIRMED POWER STILL NOT WOKING
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2024	219.30	219.30	Added 85 qts hydr, inspected arm and hydraulic control screen fixed singal finger slop
	ER36	3ALACYD20LDLW9687	YBY7704	11-15-2021	207.00	207.00	hydro tank was low and needed to be topped off
	ER36	3ALACYD20LDLW9687	YBY7704	4-26-2024	206.39	206.39	PM service. 2x fuel filters, 3x hydro filters, 1x cabin filter, grease, 26qts oil, hydro, Went to Boyer for fuel and oil filter that we did not have in stock. Part Numbers: A 936 090 06 51 - Fuel filter A 936 180 00 09 - Oil filter Boyer came to prime the fuel system.
	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	0.00	200.00	replaced trolly asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	7-15-2025	0.00	189.00	PM SERVICE
	ER36	3ALACYD20LDLW9687	YBY7704	8-16-2024	0.00	180.00	PM maint.not done
	ER36	3ALACYD20LDLW9687	YBY7704	9-18-2024	0.00	172.00	PTO WENT OUT WORKED TOGOT ARM IN SECURED COULDN'T STOW TO GET BACK TO SHOP
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2024	168.15	168.15	Added 85 qts hydr, inspected arm and hydraulic control screen fixed singal finger slop
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2024	164.60	164.60	Added 85 qts hydr, inspected arm and hydraulic control screen fixed singal finger slop
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	164.60	164.60	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2024	164.60	164.60	fixed arm stoping short toled driver how to shut the rear door
	ER36	3ALACYD20LDLW9687	YBY7704	4-11-2024	164.60	164.60	fixed finger not closing fixed leakon return line from valve
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2024	164.60	164.60	Helped replace finger bearing and 2 bushings
	ER36	3ALACYD20LDLW9687	YBY7704	6-3-2024	164.60	164.60	Inspect wobbly crank pulley and swueaky belt. Josh says its ok to leave. Filled coolant and washer fluid
	ER36	3ALACYD20LDLW9687	YBY7704	2-28-2024	164.60	164.60	leaking from valve body cover replaced it and tested
	ER36	3ALACYD20LDLW9687	YBY7704	3-27-2024	164.60	164.60	need to drain air tanks
	ER36	3ALACYD20LDLW9687	YBY7704	6-27-2024	164.60	164.60	WELD BROKEN HOSE SUPPORTS TIE UP HOSES. REPLACE REACH SENSOR HARNESS PINCHED IN BODY
	ER36	3ALACYD20LDLW9687	YBY7704	9-21-2022	163.02	163.02	filled hydro with 66 qts of hydro
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	0.00	160.00	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	0.00	160.00	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	4-26-2024	0.00	160.00	PM service. 2x fuel filters, 3x hydro filters, 1x cabin filter, grease, 26qts oil, hydro, Went to Boyer for fuel and oil filter that we did not have in stock. Part Numbers: A 936 090 06 51 - Fuel filter A 936 180 00 09 - Oil filter Boyer came to prime the fuel system.

	ER36	3ALACYD20LDLW9687	YBY7704	1-9-2024	152.31	152.31	finger bushings broken replaced
	ER36	3ALACYD20LDLW9687	YBY7704	4-26-2024	0.00	152.00	PM service. 2x fuel filters, 3x hydro filters, 1x cabin filter, grease, 26qts oil, hydro, Went to Boyer for fuel and oil filter that we did not have in stock. Part Numbers: A 936 090 06 51 - Fuel filter A 936 180 00 09 - Oil filter Boyer came to prime the fuel system.
	ER36	3ALACYD20LDLW9687	YBY7704	7-2-2025	0.00	147.00	hose made 3"
	ER36	3ALACYD20LDLW9687	YBY7704	7-15-2025	135.72	135.72	REPLACE FUSE BOX REWIRE
	ER36	3ALACYD20LDLW9687	YBY7704	7-24-2025	0.00	132.00	ARM TROLLY HOSE RIPPED OFF MADE NEW HOSE CLEANED UP HYDRO LEAK
	ER36	3ALACYD20LDLW9687	YBY7704	5-21-2025	130.76	130.76	ADDED HYDRO
	ER36	3ALACYD20LDLW9687	YBY7704	7-15-2025	0.00	126.00	REPLACE FUSE BOX REWIRE
	ER36	3ALACYD20LDLW9687	YBY7704	1-13-2025	0.00	120.00	assemble valve
	ER36	3ALACYD20LDLW9687	YBY7704	5-30-2024	0.00	120.00	Fingers not closing all the way. Replaced grabber harness, cylinder, and arm harness. Could not program it to make the fingers close all the way. Josh took over. Service call in afternoon for broken arm chain. After route - Truck came to shop for burnt out light and hydro leak. Replaced amber bulb. Replaced whole hose from body to grabber. Readjusted all hoses to twist away from arm. Bracket that holds hoses on upper arm was worn. Added Hose clamps to maintain hose position.
	ER36	3ALACYD20LDLW9687	YBY7704	10-30-2024	0.00	120.00	inspect truck grease
	ER36	3ALACYD20LDLW9687	YBY7704	3-28-2024	0.00	120.00	replaced trolley asseby and motor replaced fingers and bad hoses welded cracks in cane painted greased recal arm
	ER36	3ALACYD20LDLW9687	YBY7704	2-6-2025	0.00	120.00	Road call for engine failure. Got towed. p2729 code
	ER36	3ALACYD20LDLW9687	YBY7704	2-6-2025	0.00	120.00	Road call for engine failure. Got towed. p2729 code
	ER36	3ALACYD20LDLW9687	YBY7704	3-14-2022	118.50	118.50	replaced all 4 rollers on gripper. also topped off hyd tank.
	ER36	3ALACYD20LDLW9687	YBY7704	2-24-2022	118.50	118.50	replaced trolley transducer
	ER36	3ALACYD20LDLW9687	YBY7704	9-9-2022	117.36	117.36	replaced blower motor and harness. fan still not staying on. after digging found a bad connector in dash. repaired and it is working properly now.
	ER36	3ALACYD20LDLW9687	YBY7704	5-8-2024	116.10	116.10	add hydro
	ER36	3ALACYD20LDLW9687	YBY7704	5-21-2025	113.28	113.28	ADDED HYDRO
	ER36	3ALACYD20LDLW9687	YBY7704	6-27-2024	111.76	111.76	WELD BROKEN HOSE SUPPORTS TIE UP HOSES.
	ER36	3ALACYD20LDLW9687	YBY7704	1-13-2025	105.17	105.17	REPLACE REACH SENSOR HARNESS PINCHED IN BODY REPAIR PSCI CODE PULL PAN DOWN REPLACE PSC SOENOID HARNESS NEW FILTER
Lot#121	ER37	3ALACYD22LDLW9688	YBY7706	2-19-2024	11,073.54	11,073.54	replaced grabber assembly
	ER37	3ALACYD22LDLW9688	YBY7706	12-31-2021	2,243.90	2,243.90	unit came in with hydro leak coming from the pack 3 hydro hoses had hydro leaks from fittings . i replaced the hoses ran packer blade i seen no hydro leaks i then botton up the packer entry and sent unit back out
	ER37	3ALACYD22LDLW9688	YBY7706	2-28-2024	1,646.00	1,646.00	hose holder bent fixed replaced bolts for are base sreightend fingers and moved hoses that were rubbing adjusted arm
	ER37	3ALACYD22LDLW9688	YBY7706	1-21-2025	1,562.70	1,562.70	INSPECTED TROLLY SESNOR AND SECURED BOLTS INSTALLED NEW TROLLY SESNOR AND CALAIBRATED
	ER37	3ALACYD22LDLW9688	YBY7706	11-11-2024	1,562.70	1,562.70	recalabrated sensor came back not zeroing out replace encoder programed ok
	ER37	3ALACYD22LDLW9688	YBY7706	1-23-2025	1,562.70	1,562.70	REPLACE TROLLY SENSOR CALIBRATE
	ER37	3ALACYD22LDLW9688	YBY7706	3-6-2025	1,562.70	1,562.70	REPLACED TROLLY SENSOR
	ER37	3ALACYD22LDLW9688	YBY7706	5-7-2025	1,562.70	1,562.70	replaced trooly sensor
	ER37	3ALACYD22LDLW9688	YBY7706	4-26-2024	1,562.70	1,562.70	tilt pin broken and replaced trolley encoder
	ER37	3ALACYD22LDLW9688	YBY7706	2-24-2022	865.12	865.12	replaced amber light. replaced wire harness. brandnew one was faulty. Replaced grabber cylinder. I cant find the part number for it. Also replaced the def cap. part number on box is 111. Replaced hydraulic hose. Also replaced another hose that pertek made. I dont know the part number.
	ER37	3ALACYD22LDLW9688	YBY7706	3-21-2024	658.40	658.40	replaced leaking valvebody cover cleaned out hooper and filled recal
	ER37	3ALACYD22LDLW9688	YBY7706	6-10-2026	0.00	589.57	REPLACED PROX SWITCH TAIL GATE HYDRAULICS NOW WORK STEAMED OFF TAILGATE TO TRACE WIRING
	ER37	3ALACYD22LDLW9688	YBY7706	3-19-2026	0.00	486.00	GREASED CHASIS AND BODY
	ER37	3ALACYD22LDLW9688	YBY7706	2-22-2022	476.28	476.28	replaced trolley guide roller assembly.
	ER37	3ALACYD22LDLW9688	YBY7706	8-30-2022	345.80	345.80	Filled hydro tank .. replaced packer hydro hose and alarm hydro hose.. couldn't find part mobbers for two fittings 12z-L72 and 12z-s72.. had too goo too peppertree for another hose,.. we didn't have correct fettling.. def fluid is leaking..
	ER37	3ALACYD22LDLW9688	YBY7706	1-5-2022	340.50	340.50	truck came in with fripper issues. after looking i found 2 missing rollers and i that was about to fall off. I installed 3 new and one used. i also found a bad wire one the tilt sensor wire.
	ER37	3ALACYD22LDLW9688	YBY7706	6-5-2024	329.21	329.21	Replaced bakc up alarm. Used 2 heatshrink ss parts
	ER37	3ALACYD22LDLW9688	YBY7706	2-19-2024	0.00	320.00	replaced grabber assembly
	ER37	3ALACYD22LDLW9688	YBY7706	2-19-2024	0.00	320.00	replaced grabber assembly
	ER37	3ALACYD22LDLW9688	YBY7706	4-14-2026	0.00	304.95	FINISHED INSTALL OF WIREHERNESS HARNESS REPLACED INOP LIGHTS COMPLETED DOT CLEANED SHOP
	ER37	3ALACYD22LDLW9688	YBY7706	2-5-2025	297.65	297.65	Replaced cracked end cap.
	ER37	3ALACYD22LDLW9688	YBY7706	3-4-2026	0.00	288.00	clenaing the cabs in 32 33 37
	ER37	3ALACYD22LDLW9688	YBY7706	4-13-2026	277.73	277.73	REPLACED WIRE HARNESS
	ER37	3ALACYD22LDLW9688	YBY7706	1-15-2025	276.90	276.90	REPLACED LEAKING HYDRO HOSES ON ARM